

# McLaren Speedtail - Rear Clutch Breather Pipe Rework at 1<sup>st</sup> Service

**Bulletin type:** Service Campaign  
**Reference number:** SCB 23 G 001  
**Attention:** Retailer Service Managers and Retailer Technicians  
**Affected vehicles:** McLaren Speedtail  
**Situation:** Potential for insufficient gap tolerance between components  
**Procedure:** Action affected vehicles during 1<sup>st</sup> Service ONLY. Please refer to the information outlined in this document to ensure required gap tolerance is achieved  
**Date:** 22<sup>nd</sup> April 2021


This Service Campaign Bulletin will cover:

1. Overview
2. Parts Information
3. Procedure
4. Warranty Information
5. Affected Vehicles

## 1. Overview

Through continuous product quality monitoring, it has been identified that a number of McLaren Speedtail vehicles, may have an insufficient gap tolerance between the rear clutch breather pipe and the (right hand) secondary air hose. This could cause damage to the components; therefore a preventive rework solution has been released.

These clips are to be installed at 1<sup>st</sup> service, while the airbox is removed (for access to the oil filter housing during servicing of the vehicle).

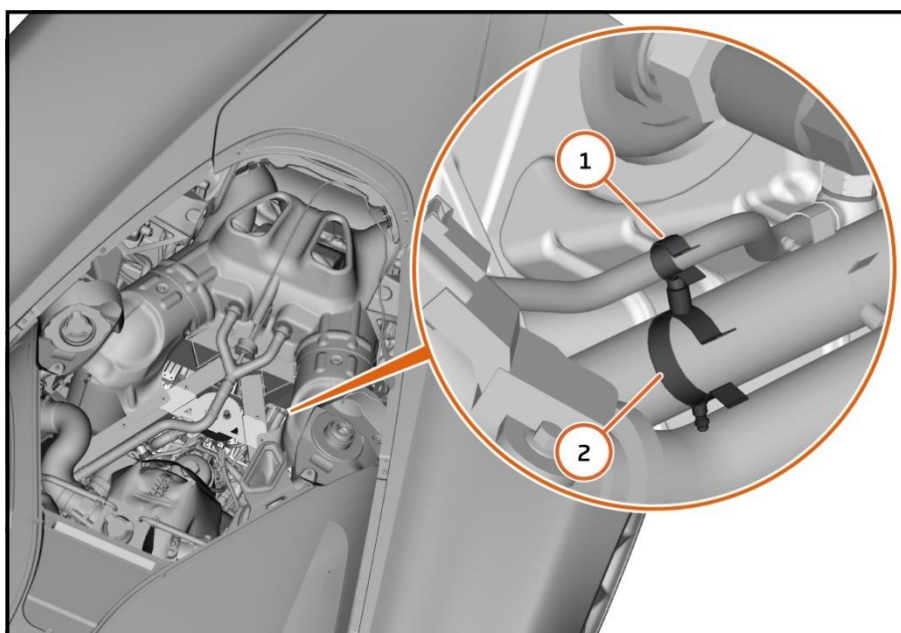

Clip - Male (1), Swivel Clip - Male + Female (2)

## 2. Parts Information

The following part(s) are required to action this repair, which can be ordered via Unipart.

Part Number	Part Description	Quantity Required
00RB045	Clip - Male	1
00RG028	Swivel Clip - Male + Female	1

## 3. Procedure

To perform the required work, follow the below steps to ensure the required repair is carried out to bring the vehicle up to the latest manufacturing standard.

- 3.1 Remove airbox as part of 1<sup>st</sup> service (GA-RM-05F003-00-002 - Drain/Fill Engine oil).
- 3.2 Install clips together and position between the rear clutch breather pipe and the (right hand) secondary air hose according to the image in section 1, to ensure required gap tolerance between the components.

## 4. Warranty Information

Submit a claim to the Warranty department following completion of the work, using the following details.

Description	Repair Time
McLaren Speedtail - Rear Clutch Breather Pipe Rework at 1 <sup>st</sup> Service	0.2 hours

**CARE POINT:** The work instruction and related labour time may be different from work instructions in the Service Information System (SIS). When you do this work you must refer only to the advice in this bulletin.

## 5. Affected Vehicles

Affected vehicles will be flagged in the Retailer Portal when next opening a workshop visit related to the vehicle.

Your Regional Aftersales Manager will also contact you with a list of affected vehicles.

If you have any questions, please speak to your Regional Aftersales Manager.

Best regards,

The information contained in McLaren bulletins is for internal use only by McLaren Authorised Retailers and must not be published on external websites or social media forums etc.

Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.

All bulletins (Information/Campaign/Recall) issued by McLaren Automotive Limited ("McLaren") are intended only for use by technicians who have attended McLaren technical training courses. McLaren trained technicians have the equipment, tools, safety instructions and the know how to perform the job properly and safely. McLaren bulletins are written to inform McLaren technicians of conditions that may occur on some McLaren vehicles, or to provide information that could assist diagnosing a McLaren vehicle.