



Technical Service Bulletin

48 Steering warning lamp is on, DTC B200FF0 is stored in the rear axle steering control module

48 21 98 2063042/1 April 29, 2021.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7, A8, and S8	2018 - 2022	All	Audi dynamic all-wheel steering
S6, RS 6, S7, and RS 7	2018, 2020 - 2022	All	Audi dynamic all-wheel steering
A6 allroad	2020 - 2022	All	Audi dynamic all-wheel steering
A6 Avant, RS 6 Avant	2021 - 2022	All	Audi dynamic all-wheel steering

Condition

Customer states:

- The steering warning lamp is on.

Workshop findings:

The following DTC is stored (sporadically or statically) in the rear axle steering control module, J1019 (address word 00CB):

- **DTC B200FF0** (internal malfunction) with symptom code 251.

Technical Background

The internal monitoring function in the control module responds prematurely.

Production Solution

Improved software is under development.



Technical Service Bulletin

Service

Proceed as follows:

Option 1: Passive/sporadic entry: Delete the DTC and release the vehicle.

Option 2: Active/static entry: Perform the rear steering basic settings in the self-diagnosis of the control module.

- A login code is necessary for this procedure: Code **20103**.
- Afterward, release the vehicle.



Note:

This procedure must only be used for the symptom code 251 as specified above.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4841		
Damage Code:	0040		
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 30 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	0121 0004	10 TU
Claim Comment:	As per TSB #2063042/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information



Technical Service Bulletin

All part and service references provided in this TSB (2063042) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2021 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.