

DTNA Solutions > Service Solutions > Freightliner  
> SS 3076-FTL2021 P4 Main Mirror Arm Covers Loose - ...

# SS 3076-FTL2021 P4 Main Mirror Arm Covers Loose - Falling Off

## Applicable Vehicles

All New Cascadias

## Symptoms

Lower arm covers LH/RH loose or falling off.

## Issue

Lower arm covers designs have clips that hold the cover on but over time the clips can fail and allow the covers to become loose or fall off.

## Solution

Add a push pin or screw to secure the Arm Covers in Place as shown in the following figure:

# P4 Mirror - Arm Cover Field Service Fix

- RH mirror shown
- Dimensions are approximate
- Drill 1/8" diameter hole through cover and into bezel to apply push connector 23-12251-001.
- As alternate drill 1/8" diameter hole and use #8 screw WWS 4014-3417 screw instead of 23-12251-001.
- See next slide for process details



Figure 1: Installation of push pin - screw.

Labels :

New Cascadia

Add tags

0 Kudos

Comment