

No Keyless-Go functionality in rear area

Topic number	LI80.61-P-072709
Version	1
Function group	80.61 - Keyless-Go/Keyless-Entry
Date	3/24/21
Validity	Model series 223 Maybach
Reason for change	

Complaint

Hands-free Access, trunk lid opening via KG as well as 'closing and locking' via inside trunk lid button nonfunctional.

Cause

The cause may be due to the Keyless-Go antenna in the trunk not being connected.

Important: The corresponding fault code B1A5113 "The rear LF 'Keyless-Go' antenna has a malfunction. There is an open circuit." is not stored.

Remedy

Check connector coupling of LF antenna in trunk for correct contacting.

Symptoms				
Overall vehicle > Safety and locking system > Keyless go > Function > Card not detected				
Overall vehicle > Safety and locking system > Keyless go > Function > Vehicle does not open				
Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note