

Armrest In Center Console (Front) Only Opens On One Side Or Not At All - Model Series 167

Topic number	LI68.20-P-070037
Version	6
Function group	68.20 - Center console
Date	3/26/21
Validity	BR167
Reason for change	Availability of repair kit

Complaint

Armrest in center console (front) only opens on one side or not at all.

Cause

Cause 1: The hook on which the pop-up spring is hooked into may be broken.

Cause 2: The pop-up spring could not be correctly hooked into the catch hook. Consequently, it may have slipped off its shaft.

Remedy

Installation of repair kit A 167 680 86 11. Thanks to the repair kit, it is no longer necessary to replace the armrest for the stated fault profiles.

Attachments	
File	Description
RS Armrest Center Console_A167 680 86 11_nonverbal_16032021.pdf	Installation instructions for repair kit

Symptoms
Body > Interior equipment > Stowage box/tray > Warped/twisted/distorted
Body > Interior equipment > Stowage box/tray > Broken

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A1676808611			Armrest repair kit	1		X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note

