

SSM 49762: 2020-2021 Escape/Corsair, 2021 Bronco Sport ☐ Diagnostic Trouble Code (DTC) U3000 In Power Steering Control Module (PSCM) When Battery Charger Installed

Some 2020-2021 Escape/Corsair, 2021 Bronco Sport vehicles may exhibit a lack of power steering assist with DTC U3000 in the PSCM. This DTC is set when a battery charger is installed on the vehicle and the ignition is cycled ON. For vehicles that set this DTC due to the use of a battery charger, the DTC can be cleared and power steering assist restored without replacement of the PSCM. Using the FDRS, select and run the PSCM - Reset the Power Steering Control Module (PSCM) application. Once cleared, cycle the ignition. Reprogram the PSCM using the latest version of FDRS. It is not recommended that a battery charger be installed and running on the vehicle when the ignition is cycled. For claiming, use causal part 3C529 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

Vehicles:

2021	Bronco Sport (CX430) (HD)
2020-2021	Corsair (CX483) (TF)
2020-2021	Escape (CX482) (TC)