



SERVICE BULLETIN

Can-Am® On-Road

April, 2021

Subject: **Repair Procedure Revision - Brake Light
Switch Adjustment**

No.

2021-4

SERVICE INFORMATION


YEAR	MODEL
2020 and newer	Spyder RT
2019 and newer	Ryker

Vehicle may indicate brake light switch failure, rear brake light stays ON or flashes intermittently. One of the probable cause is the adjustment of the brake light switch / low pressure switch.


NOTE: The rear light should stay OFF when the brake pedal is released or with a small movement of less than 4 mm (5/32 in).

BUDS2 will return one or more of the following codes:

- C0040 - Brake light switch failure
- P061E - Brake signal state Invalid
- P0504 - Brake signal not plausible
- C0042 - Low brake pressure switch
- C1182 - Brake failure (low pressure switch)

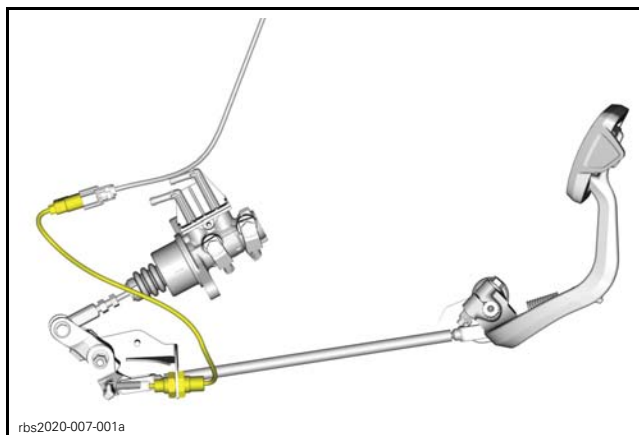

SPYDER RT

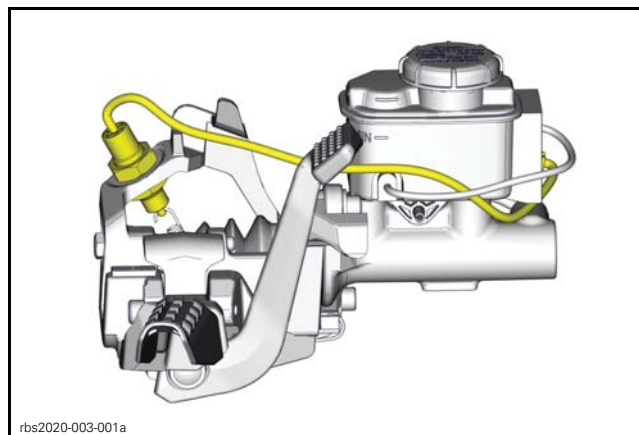

RYKER

PROCEDURE

Refer to the following procedures.

- **Task:** *INSPECTING THE ADJUSTMENT OF THE BRAKE LIGHT SWITCH / LOW PRESSURE SWITCH (BLS/LPS).*
- **Task:** *ADJUSTING THE BRAKE LIGHT SWITCH / LOW PRESSURE SWITCH (BLS/LPS).*

Always refer to the appropriate *ONLINE SERVICE MANUAL* for the latest informations and procedures.