

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Document Information

Vehicles affected: P11: 675LT

Location: Interior - Interior Restraints

Topic: Airbag warning light

Condition: Permanent

Diagnostic Trouble Codes: N/A

Measure

All McLaren 675LT models have an extra Pyrotechnic module which the ORC module uses to recognise the model of the vehicle.

If a customer of a 675LT vehicle complains that the airbag warning light has illuminated but no DTC is found during DTC read, check with following actual value within the ORC module:

“Side airbag driver squib resistance value”

The value should be 2.30

If the value is 25.00, the extra Pyrotechnic module is either disconnected, faulty or there is an associated wiring fault.

The image below shows the location of the Pyrotechnic module.



Parts Information

N/A

Attachments

N/A

KA Updates Information

21/04/2021 - Template Updated

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.