

DTNA Solutions > Discussions and Feedback > Tech Talk > 1592/9



 William_Atkinso

Lube Tech

05-06-2020 10:56 AM

1592/9

NOT SURE WHERE TO PUT MY SOLUTION. HAD CODE 1592/9 (FRONT AXLE, LEFT WHEEL SPEED - ABNORMAL UPDATE RATE) IN HEADWAY CONTROLLER. AFTER SEVERAL HOURS FOUND OUT THROUGH WABCO THAT WHEN NEW ABS MODULE WAS PROGRAMMED IT HAD SOME EXTRA SOFTWARE THAT SHOULD NOT BE THERE. HAD TO GET A DOWNLOAD FROM WABCO TO FIX THE PROBLEM.

Labels :

Brakes | Air | and Hydraulic Systems

Cascadia

DTNA eComponents

Electronics | Controls | Configuration | Communication | and Diagnostics

Freightliner

Add tags



5 Kudos

Reply



 Scott_Trippel

Optimus Prime

05-07-2020 06:58 AM

Thanks for the heads up...love Wabco

Add tags



0 Kudos

Reply



Cary_Durden
Apprentice

11-13-2020 12:07 PM

Just had the exact same issue with a unit in the shop. Replaced the ABS ECU (new part number is 400 865 044 0) and then fault 1592 FMI 9 came active in the headway controller. Wabco emailed me "TOOLWrench 2.16.1" for the sole purpose of Enabling the HRW (High Resolution Wheel) Speed in the ABS ECU. No faults after programming.

Add tags



2 Kudos

Reply



Clayton_Campbel
Piston Head

04-08-2021 07:58 AM

very helpful,... thanks

Add tags



0 Kudos

Reply

Powered by

