 HYUNDAI Technical Service Bulletin	GROUP BODY ELECTRICAL	NUMBER 21-BE-007H
	DATE APRIL, 2021	MODEL(S) ELANTRA (CN7a)
SUBJECT: REAR COMBINATION LAMP TURN SIGNAL BULBS REPLACEMENT		


Description: Some 2021 Elantra (CN7a) rear combination lamp turn signal light bulbs may prematurely become inoperative. This bulletin describes the procedure to replace the rear combination lamp turn signal light bulbs for both the right and left side.



Applicable Vehicles: Certain 2021 MY Elantra (CN7a)

SUBJECT: REAR COMBINATION LAMP TURN SIGNAL BULBS REPLACEMENT

Parts Information:

PART NAME	PART NUMBER	PART IMAGE	QTY.
Turn Signal Light Bulb	18642-21007L NOTE: Applies to both left and right side.		2

Warranty Information:

MODEL	OP. CODE	OPERATION	OP. TIME	CAUSAL PART	NATURE	CAUSE
Elantra (CN7a)	00DA41R0	Rear Combination Lamp Turn Signal Bulb Replacement	0.3 M/H	18642-21007L	I11	ZZ3

NOTE 1: Submit Claim on Campaign Claim Entry Screen.

NOTE 2: If a part is found in need of replacement while performing the repair for this TSB, and the affected part is still under warranty, please submit a separate claim using the same Repair Order. If the affected part is out of warranty, submit a prior approval request for goodwill consideration prior to performing the work.


NOTE 3: Please note that op code is for replacement of bulbs on both sides.

Service Procedure:

1. Open the trunk to access the rear combination lamp assembly.
2. Remove the rear combination lamp cover.



3. Remove the three 10mm nuts.

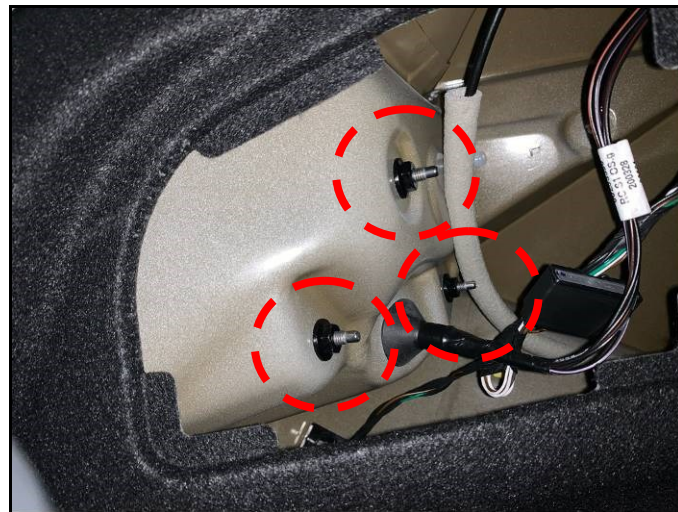

4. Carefully remove the rear combination lamp assembly.

Remove and replace the turn signal light bulb.



5. Reinstall all parts in reverse order of removal.
6. Perform the same procedure to the other side to replace the turn signal bulb.
7. Confirm the turn signal of both the left and right sides are operating normally.