	GROUP CLI	MODEL 2022MY Stinger (CK) w/3.3L T-GDI
	NUMBER 050	DATE May 2021

TECHNICAL SERVICE BULLETIN

**SUBJECT: SERVICE ACTION: HEATER HOSE CLAMP INSPECTION
AND REPLACEMENT (SA479)**

This bulletin provides the procedure to inspect and if necessary, replace the heater hose clamp on some 2022MY Stinger (CK) vehicles equipped with 3.3L T-GDI LAMBDA II engine, which may have had the incorrect diameter hose camp installed in one of the hose ends during assembly. The larger Ø24 diameter hose clamp may cause the heater hose to leak coolant. To correct this concern, replace the Ø24 with the correct Ø21 hose clamp. Before conducting the procedure, verify that the vehicle is included in the list of potentially affected 47 VINs.



★ NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

This issue number is SA479.

Printed TSB copy is for reference only; information may be updated at any time.
Always refer to KGIS for the latest information.

Circulate To: General Manager Service Manager Parts Manager
 Service Advisors Technicians Body Shop Manager Fleet Repair


Inspection Procedure:

1. Open the hood and remove the engine cover.




2. Locate the heater hose (A) and confirm the correct hose clamp(s) size stamping is found on opposite ends as shown.


- If the $\text{\O}24$ is found on the end requiring the $\text{\O}21$ size hose clamp, proceed to the '**Replacement Procedure**' outlined below.

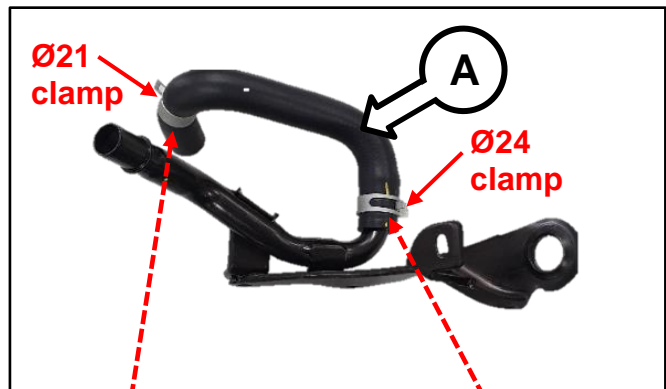

- If the $\text{\O}24$ and $\text{\O}21$ hose clamps are found to be correctly installed in their corresponding ends, no further action is required. Reinstall the engine cover.

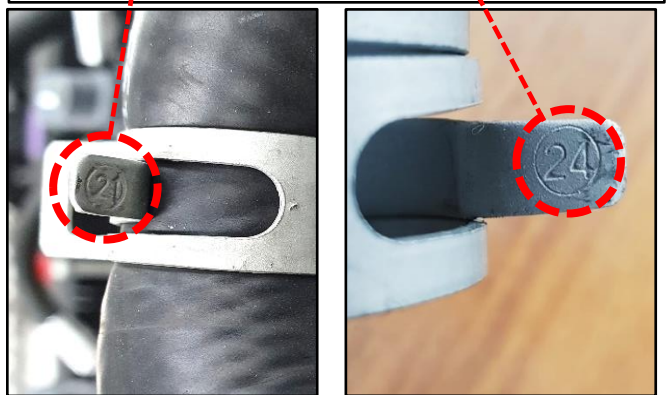**Replacement Procedure:**

1. Using a set of pliers, turn the heater hose clamp (B) counterclockwise. Remove the $\text{\O}24$ clamp.
2. Install the correct $\text{\O}21$ hose clamp.
3. Confirm normal vehicle operation and no leaks are present.
4. Reinstall the engine cover.

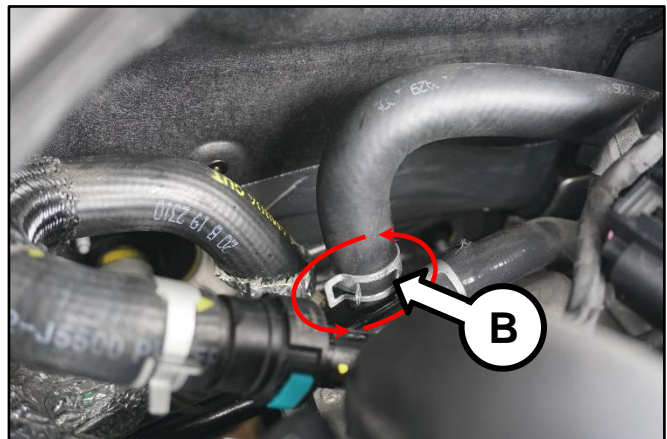

SUBJECT:

SERVICE ACTION: HEATER HOSE CLAMP INSPECTION AND REPLACEMENT (SA479)

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Stinger (Ck)	March 25, 2021 to April 7, 2021

REQUIRED PART:

Part Name	Part Number	Figure	Qty.
Hose Clamp (Ø21)	14720 21006S		1

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	22340 3L201	0	(SA479) Inspection of Heater Hose Clamp Size	21007R0	0.2 M/H	N/A	0
			(SA479) Inspection and Replacement of Heater Hose Clamp	210071R1	0.4 M/H	14720 21006S	1

Use sublet code 'X1' for use of prediluted coolant (maximum allowance of \$2.49. When necessary, manually enter sublet code 'X2' for reimbursement for one roundtrip rideshare expense or up to three (3) days of rental for hose clamp replacement.

* NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SA479** when accessing the WebDCS system.

