



Service Bulletin

Bulletin No.: 21-NA-102

Date: April, 2021

INFORMATION

Subject: Information on Replacing Hood Latch

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2016	2018	—	—	All	All


Involved Region or Country	North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Ecuador, Paraguay, Peru, Japan, GM Korea Company, China, Taiwan, Philippines
-----------------------------------	---

Information

When replacing the hood latch, the service replacement P/N 84678990 will also require the use of connector P/N 19368220. This new service latch has a three-wire connector, while the original latch P/N 84053842 on Model Years 2016-2018 will only have a two-wire connector.

Service Procedure

1. The new connector will come with three leads. The yellow wire needs to remain installed for water intrusion protection. The extra lead needs to be sealed using a DuraSeal splice sleeve and taped back into the harness. Refer to *Wire to Wire Repair* in Service Information (SI) for more information.
2. The schematic document ID: 4673035 in SI shows a purple wire on the latch - on the new connector this is a red wire. Connect the red wire on the connector to the BN/GN wire in the vehicle harness.
3. Connect the black wire on the connector to the black wire on the vehicle harness.

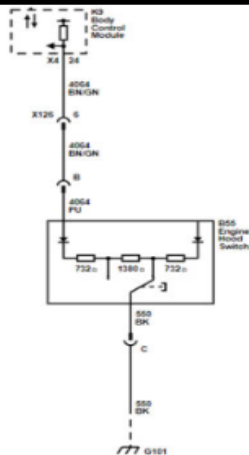

Parts Information

Causal Part	Description	Part Number	Qty
X	LATCH ASM – HOOD PRIM & SECD	84678990	1
	CONNECTOR KIT, WRG HARN	19368220	1

5807138

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1410280	Hood Primary and Secondary Latch Replacement	Use Published Labor Operation Time

Version	1
Modified	Released April 23, 2021

