

2020 Lexor

1.COMPLAINT: Guest states leak coming from grey tank pipe under coach. // Advisor found a leak coming from the curve of the pipe where it has a wrap on it.

CAUSE: Found grey water pipe leaking between tank and dumbo valve, Removed heat shield from pipe. Found pipe with a crack with no evidence of rubbing or chaffing. Heat shield tape was intact. Need to drain the tank completely, remove all tape cut out sections of pipe approx 2 feet. Add new pipe and flue together with 2 couplings. Also need to leak check when complete. Need to complete

CORRECTION: Drained tank completely, removed all heat shield tape and aluminum heat shield clamped on. Cut on section of cracked pipe. Added 2 coupling and new section of pipe approx 2 feet. Glued in section and leak checked tank by filling up. Left at 25%. Added heat shield tape/insulation through and added aluminum heat shield with 2 new clamps. TIME: @ 3.00hr 1.2 approved maximum. It's just one straight section that you are replacing and our tech can do this in 30 minutes.