



# Technical Service Bulletin

---

**97 Parking aid is not working, DTCs B10FA14, B10FA31, B10F804, B10F814, or B15EC14 are stored in the parking aid module**

97 21 80 2063269/1 May 17, 2021.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q3	2019 - 2020	All	Parking aid
Q3	2021	000001 - 084187	Parking aid

## Condition

### Customer states:

- A parking aid warning is displayed in the instrument cluster.

### Workshop findings:

The following DTCs relating to the front parking aid sensors may be stored as static or sporadic in the parking aid control module, J446 (address word 0076):

- **DTC B10FA14** (Right front parking aid sensor Open circuit/short circuit to Ground (GND)).
- **DTC B10FA31** (Right front parking aid sensor No signal).
- **DTC B10F804** (Left front center parking aid sensor faulty).
- **DTC B10F814** (Left front center parking aid sensor Open circuit/short circuit to Ground (GND)).
- **DTC B15EC14** (Voltage supply for front parking aid sensor Open circuit/short circuit to Ground (GND)).

## Technical Background

The wiring harness in the front bumper can rub against the bumper carrier causing it to chafe.

## Production Solution

New wire harness installed in production.

## Service

If the above customer concern and DTCs are stored, inspect the front bumper harness for damage.

If there is no damage found on the front bumper harness, this TSB does not apply. Continue with normal diagnosis.



# Technical Service Bulletin

---

1. Inspect the wiring harness in the front bumper for any signs of chafing (red arrow in Figures 1 - 2).



**Figure 1.** Example of parking aid harness that has chafing.



**Figure 2.** Example of parking aid harness that has chafing.

2. If damage is found on the wiring harness, replace the parking aid wiring harness.



# Technical Service Bulletin

---

**Note:**

All wiring harnesses available from the parts department are optimized versions.

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	9759		
<b>Damage Code:</b>	0025		
<b>Labor Operations:</b>	Remove and install front bumper cover	6329 19XX	See SRT with associated operations
	Check bumper wiring harness	9759 0199	10 TU
	Remove and install bumper wiring harness	9759 1950	See SRT with associated operations
<b>Diagnostic Time:</b>	GFF	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB #2063269/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



# Technical Service Bulletin

---

## Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA	Wiring harness for front bumper	01

## Additional Information

All parts and service references provided in this TSB (2063269) are subject to change and/or removal.

©2021 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.