



GROUP <b>Body</b>	MODEL <b>Soul</b>
NUMBER <b>046</b>	DATE <b>July, 2009</b>

## TECHNICAL SERVICE BULLETIN

**SUBJECT:**

SERVICE ACTION: MOOD LAMP CONTROL UNIT REPLACEMENT (SA010)

This Service Action provides information on 2010 Soul (AM) vehicles manufactured between January 15<sup>th</sup> and May 25<sup>th</sup>, 2009, having the Audio Upgrade Package and Mood Lamp Speaker Illumination. With 'music mode' selected, the illuminated mood lamp speaker illumination (LED's) may not operate as expected at interior temperatures above 60 degrees Fahrenheit due to an internal problem of the mood lamp control unit. Replacing the mood lamp control unit with part number 96120 2K510QQK will correct this problem.



**\* NOTICE**

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service> Warranty Coverage> Warranty Coverage Inquiry> Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs> Not Completed Recall> Recall VIN> Select Report), which includes a list of affected vehicles.

This issue number is SA010.

File Under: General Information

- Circulate To:  General Manager  Service Manager  Parts Manager  
 Service Advisors  Technicians  Body Shop Manager  Fleet Repair

**SUBJECT:** SERVICE ACTION: MOOD LAMP CONTROL UNIT REPLACEMENT (SA010)

## AFFECTED VEHICLE RANGE:

Model	Production Date Range
2010 Soul (AM)	January 15, 2009 to May 25, 2009

## REQUIRED PART:

	Mood Lamp Control Unit	
	Previous Part Number	New Part Number
<b>Part No.</b>	96120 2K510	96120 2K510QQK
<b>Remarks</b>	<b>IMPORTANT:</b> The part number printed on the bar code label of the new mood lamp control unit is 96120 2K510. When installing a new mood lamp control unit, use only the part number printed on the packaging (96120 2K510QQK) to properly identify the mood lamp control unit assembly. Pay no attention to the part number printed on the bar code label of the mood lamp control unit.	

## REQUIRED SST:

None

## WARRANTY INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	96120 2K510	0	N94	C63	Mood Lamp Unit Replacement	090026R0	0.3	96120 2K510QQK	1

<b>* NOTICE</b>
-----------------

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA010 when accessing the WebDCS system.
---