



GROUP Body	MODEL Forte/Forte Koup
NUMBER 049	DATE October, 2009

TECHNICAL SERVICE BULLETIN

SUBJECT: SERVICE ACTION: ENGINE COMPARTMENT
JUNCTION BOX RELAY REPLACEMENT (SA012)

Some Forte/Forte Koup vehicles manufactured from July 16th to August 20th, 2009 may experience concerns of inoperative A/C blower, high/low cooling fans or engine start motor. The concern may be caused by poor contacts inside the four (4) relays located in the engine compartment junction box as shown below. It is recommended that all vehicles within this production range be repaired prior to retail sale to a customer. Additionally, vehicles being in for service should be checked and if necessary repaired before returned to the customer.

* NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Repairs requested to perform this repair outside the warranty period will require a fee.

Repair status can be viewed on webDCS (Service Warranty Coverage > Warranty > Campaign Information > New Initiatives > Recall / Service Action > Search on WebDCS (Customer Affairs > New > Completed Recall > Search > Support), which includes a list of affected vehicles.

Service number is SA012.

BOD049 / SA012
CLOSED



Location of Four Relays to be Replaced
With Part Number 95224 1M000QQK

File Under: Service Campaign


- Circulate To: General Manager Service Manager Parts Manager
 Service Advisors Technicians Body Shop Manager Fleet Repair

SUBJECT: SERVICE ACTION: ENGINE COMPARTMENT JUNCTION BOX RELAY REPLACEMENT (SA012)

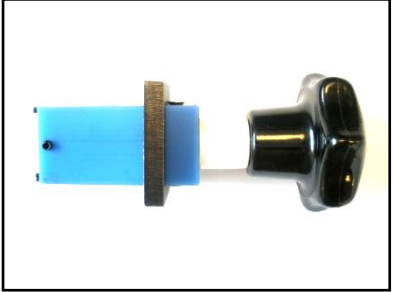
AFFECTED VEHICLE RANGE:

Model	Production Date Range
Forte/Forte Koup (TD)	From July 16th to August 20th, 2009

REQUIRED PART:

Part Name	Part Number	Figure
Relay Kit (Kit Consists of 4 Relays)	95224 1M000QQK (Previously 95224 1M000)	 <div style="border: 1px solid black; padding: 5px; margin-top: 5px; text-align: center;"> New Relay is Identified by White Dot </div>

REQUIRED SST:

SST Name	SST Number	Figure
Relay Remover	09912 - 38000	

WARRANTY INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	95224 1M000	0	N94	C15	(SA012) Engine Compartment Junction Box Relay Replacement	090045R0	0.2	95224 1M000QQK	1

*** NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA012 when accessing the WebDCS system.