

SSM 49830 - 2020-2021 Explorer/Aviator - Hybrid - Rattle/Buzz Noise From The Center Console/Cowl Area - Engine Speed Around 1500 Revolutions Per Minute (RPM)

Some 2020-2021 Explorer/Aviator Hybrid vehicles may exhibit a buzzing noise coming from the center console or cowl area with engine speed around 1500 RPM at idle or while driving. This may be due to the transmission park manual release cable vibrating against the transmission. This can be resolved by isolating the transmission park manual release cable with Rotunda PVC foam tape (164-R4901) or equivalent, where it is contacting the transmission. Replacement of the transmission park manual release cable is not necessary.

APPLICABLE VEHICLES

2020 - 2021 CAR: TV U611N AVIATOR

2020 - 2021 CAR: TW U625N EXPLORER