

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Document Information

Location: Powertrain Systems - Cooling System


Topic: Hybrid System Fault warning message on the instrument cluster

Condition: Permanent

Diagnostic Trouble Codes: N/A

Measure

The warning message "Hybrid System Fault" (screenshot below) is **not** related to the vehicle's Hybrid System when is not followed by "12V Battery Discharging" and Engine MIL light.

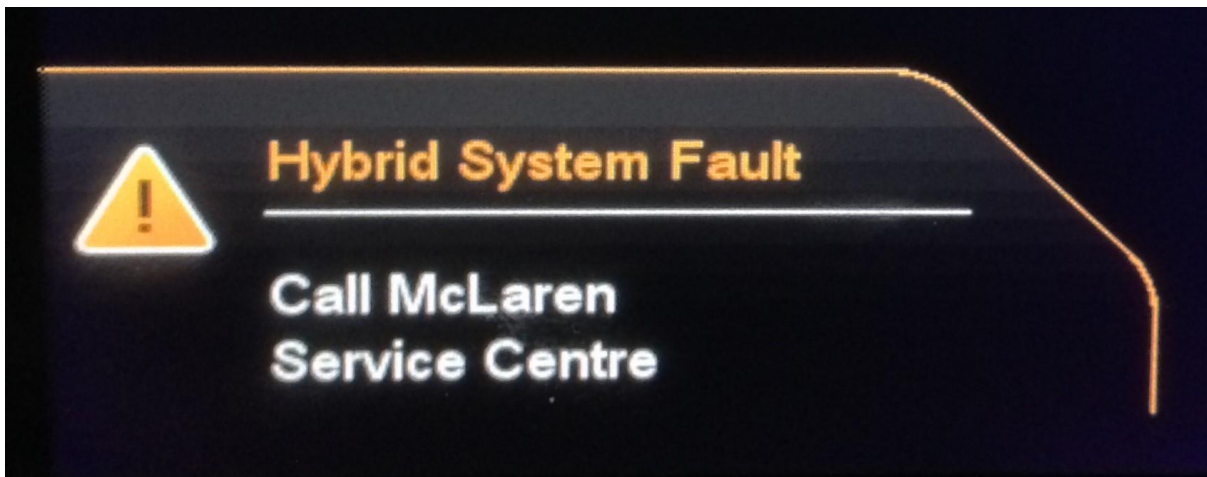

This warning message relates to the coolant system of the vehicle and does not generate a DTC.

- Check the engine coolant level.

- With the use of the coolant displacement tool kit, check the coolant displacement. Refer to SIS instructions BA-RM-04L001-00-001 - Drain/fill fluid - cooling system - Step 23.
If the displacement is outside the limit, proceed with the full vacuum bleed of the coolant system as per the SIS instructions.
- Once the coolant displacement is within the limits, test drive the vehicle to confirm the warning message is not returned.

Parts Information

N/A

Attachments

N/A

KA Update Information

11/05/2021 KA Review

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.