

WLK2 Workshop campaign - Checking electric charge port doors and replacing them if necessary

Version 1

Overview

There is a possibility that the end position of the charge port doors is not determined correctly on the affected vehicles due to an incorrect sensor signal.

The charge port door on the opposite side of the vehicle is then locked automatically and can no longer be operated. The defective charge port door can still be actuated without restriction from the center console or by a hand gesture at the charge port door.

In order to ensure correct functioning of the charge port doors, both charge port door wire harnesses must be replaced.

Please ensure this measure is carried out prior to delivery for inventory vehicles.

Model type

Taycan (Y1A)

Model year	2020
Vehicle specifications	Electric charge port door (I-no. 2W9)
Number	412

Parts required:

Part No.	Designation	Quantity/vehicle	Parts return*
9J1898352Q	Wire harness for charge port door – Charge port door A (driver's side)	1 ea.	No
9J1898352R	Wire harness for charge port door – Charge port door B (passenger's side)	1 ea.	No
PAF008485	Hexagon flange bolt, M6 x 12 – Door hinge	2 ea.	No
PAF912032	Countersunk screw with internal serration, M8 x 22 – Door arrester	1 ea.	No

* The parts must be stored until such time as the related warranty or campaign claim has been credited. If a barcode is generated with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the genuine remanufactured parts process or be scrapped.

Ordering required parts

The required parts are available and can be ordered as required by dealers without the need for PRMS ticket or email to release.

Warranty processing

Validity:

This workshop campaign will be carried out up to 02/18/2026 and will be closed by the specified date. Please note that warranty claims can only be processed before this date.

Scopes 1-3: No longer relevant because the check is no longer carried out.

Scope 4: Checking electric charge port door and replacing wire harness on charge port door A and B

Damage Code	WLK2 66 000
Repair Code	2
Working time	147 TU

Parts required:

9J1898352Q	Wire harness for charge port door A (driver side)	1 ea.
9J1898352R	Wire harness for charge port door B (passenger's side)	1 ea.
PAF008485	Hexagon flange bolt, M6 x 12	4 ea.
PAF912032	Countersunk screw with internal serration, M8 x 22	2 ea.

Please enter the campaign that was carried out in the Warranty and Maintenance booklet for the vehicle.

Porsche Mobility

If requested, the mobility of the affected customer can be assured by offering a suitable replacement vehicle.

Please invoice this additional service with the campaign scope via WWS.

Further information

Work instruction	TI No. 161/20, Group 5, Service, WLK2
Vehicle list and allocation	See PCSS or attached list for reference
Technical Information	See PCSS or Aftersales Document Database for reference

[WLK2 VIN List.xlsx](#) ⓘ

16.5 KB

(87 views)

Created by [Ryan Cooney](#) on Apr 30, 2021 11:12 PM. Last modified by [Ryan Cooney](#) on May 1, 2021 2:30 AM.

809 Views [Report Abuse](#)

Categories: [Taycan](#), [Workshop Campaigns](#)

Tags : [taycan](#), [charge port door](#), [y1a](#), [charge port](#), [wlk2](#)

Content and Topics

Your Groups >

Your Content >

Your Places >

Personal

Edit Profile >

Change Password >

Manage

Admin Console >

PPN Administration >

Create

Discussion >

Files >

Document >

Collaboration >

Document

Blog Post >

Poll >

Event >

Photo Album >

Idea >

Space >

Group >

