


Title:	Cab Door Window Guide Adjustment			
Number:	KA_575	Release Date:	05/07/2021	
Revision Number:	Not Applicable	Revision Date:	Not Applicable	
Chassis Type:	All chassis types			
Component Description:	Cab Door Window Guide			
Warranty:	Not Applicable			
Parts:	Not Applicable			
Tools:	Not Applicable			


Subject:

There have been reports of cab door windows sliding forward causing the window to “bind” when the window is operated. This knowledge article outlines the suggested adjustment to the door to resolve this issue.

Procedure:

If cab door windows experience binding, the following steps should be completed:

1. Remove the inside panel of the door to expose window track system.
2. Located the two adjustment screws on the top inside corner of the door showing with yellow arrows below.

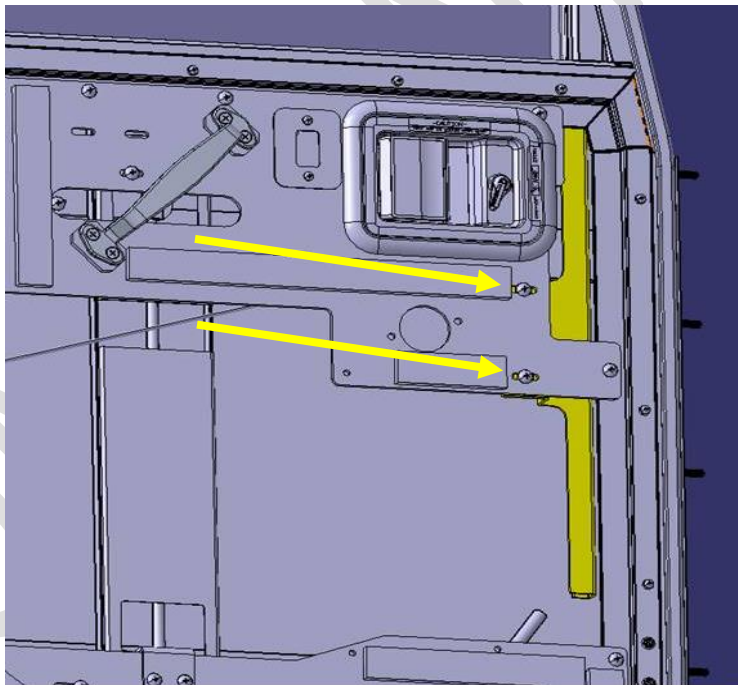

3. Loosen these two screws, if necessary, to give movement to the horizontal window trim bracket.
4. Move the window trim bracket back toward the cab to a position where it clears window regulator and latch linkages.
5. Tighten the screws showed in step 2 back down to hold the bracket in place.
6. Test the function of the window, if it continues to bind repeat steps 3-5 until the bracket is in a position where it clears the window regulator and latch linkages.
7. Reinstall the inner door panel.

If any additional support is needed, please open a technical support incident on Pierceparts.com.