



## Volvo Chassis - Model VNR With RH Side Fairing Only - Heat/Splash Shield Loose, Possible DTC P204800 And/Or P204713



On certain Volvo VNR chassis equipped with a right-hand (passenger) side fairing, there is a possibility that the bolts securing the EATS heat shield/splash shield may become loose. This may lead the shield to rub on the EATS wiring harness, resulting in damage.

Diagnostic Trouble Codes (DTC) P204800 and P204713 may be observed as a result of the harness fatigue due to the loose shield.



## Repair


1. Remove the 2 bolts (#14 in the image below) securing the heat shield.
2. Apply blue Loctite to the threads of the bolts.



Install the bolts with the addition of a jam nut, part number 000050, to the end of each bolt.

990930, to the end of each bolt.

- The bolts should be torqued to  $12 \pm 2$  Nm ( $9 \pm 1.5$  lbf)

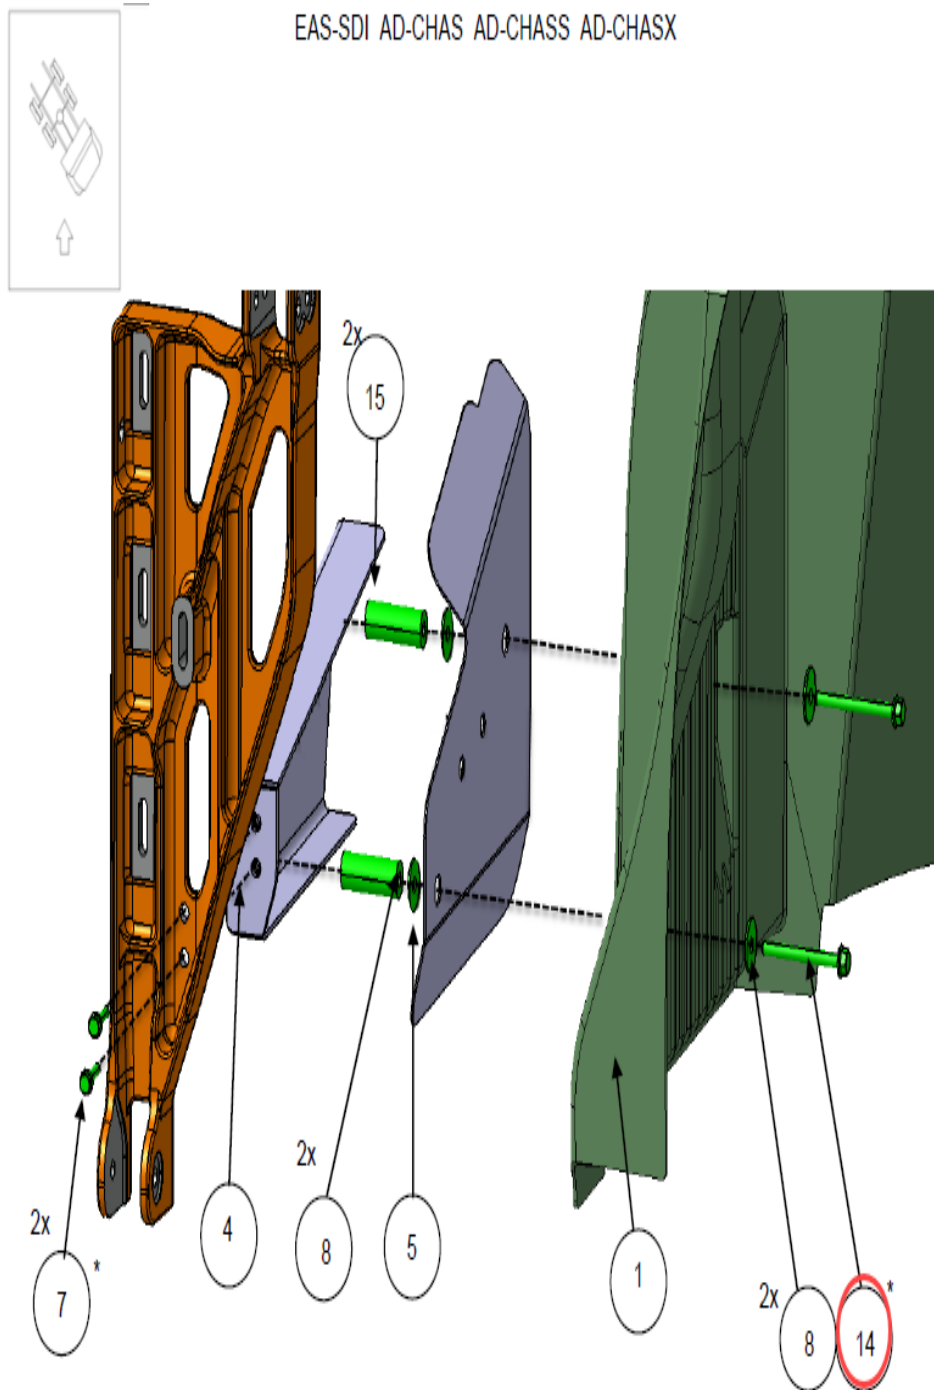

\* TORQUE TO  $12 \pm 2$  N-m



Tags

[p204800](#)[p204713](#)[eats wiring harness](#)[rub](#)[harness damaged](#)[broken harness](#)[heat shield loose](#)

## Related links and attachments

No links or attachments available



## Feedback

[Give feedback](#)

to help improve the content of this article