



Mack Chassis - Radio Loses Presets And Time Setting - Terrapro Models (MRU, TE)




Mack Terrapro models built between 1 January 2017 and 15 February 2021 may lose radio memory after the battery switch is turned to the off position. If this symptom occurs, it may be due to the radio jumper harness being incorrectly connected to the main cab harness.

The connectors are located near FRC1 and labeled “A158_JMP1.A” and “A158_JMP2.A”.

The jumper connector P/N 25159660 should be connected in "A158_JMP2.A" **not** "A158_JMP1.A" to provide the memory fix.

Refer to the images below for reference.

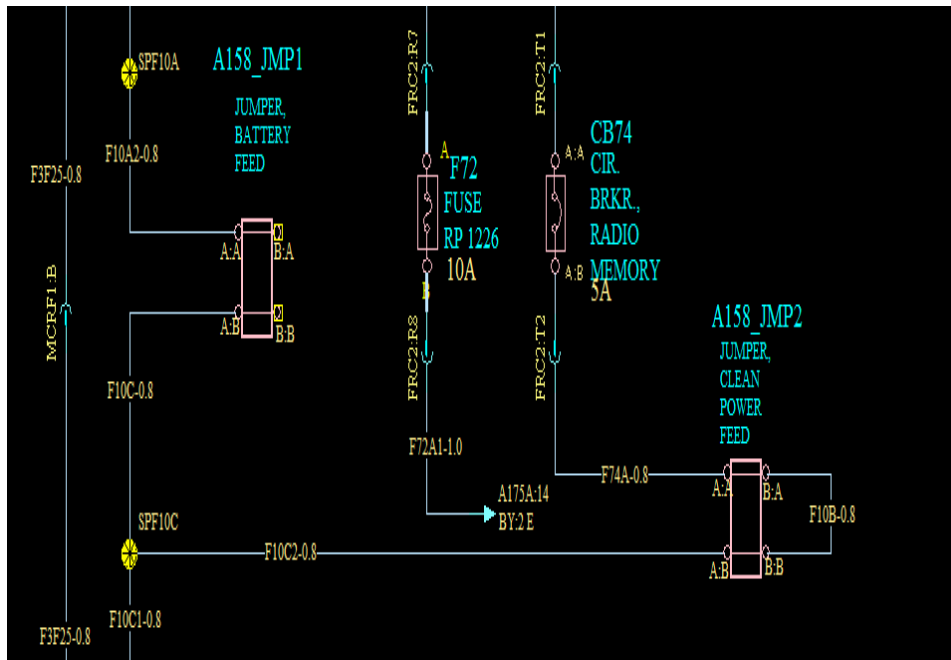

Secured Wire bundles





“A158_JMP1.A” and “A158_JMP2.A” pulled from the bundle



**Completed repair. (Jumper has been moved from JMP1.A to JMP2.
A)**





Tags

[radio presets](#)[radio memory](#)[mack](#)

Related links and attachments

No links or attachments available



Feedback

[Give feedback](#)

to help improve the content of this article