



GROUP
Body

MODEL
Sedona (VQ)
w/Power Tailgate

NUMBER
051 REVISED

DATE
December 2009

TECHNICAL SERVICE BULLETIN

SUBJECT: SERVICE ACTION: POWER TAILGATE IPM UPDATE
TO PREVENT BATTERY DISCHARGE (SA021)

This **revised** bulletin – a BLACK BAR to the left of the procedure (as shown here) indicates REVISED instruction – provides information relating to a running change made on Sedona (VQ) models with power tailgate package produced prior to 6/20/2009. Some Sedona (VQ) models may complain after operating the rear tailgate and then turning OFF the ignition. Within 30 seconds, the battery may become discharged due internal logic of the IPM hold open internal timer ON and creating a small parasitic current draw. To correct this condition, the IPM should be reprogrammed using the GDS download as described in this bulletin.



PROGRAM NAME
8.00 IPM LOGIC UPDATE

* NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service> Warranty Coverage> Warranty Coverage Inquiry> Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs> Not Completed Recall> Recall VIN> Select Report), which includes a list of affected vehicles.

This issue number is SA021.

File Under: Body

- Circulate To: General Manager Service Manager Parts Manager
 Service Advisors Technicians Body Shop Manager Fleet Repair

SUBJECT: SERVICE ACTION: POWER TAILGATE IPM UPDATE
TO PREVENT BATTERY DISCHARGE (SA021)

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sedona (VQ) with Power Tailgate Option	October 1, 2005 to June 20, 2009

WARRANTY INFORMATION:

Claim Type	Causal P/N	Qty.	N Code	C Code	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	91954 4D070	0	N61	C40	(SA021) IPM Update	090031R0	0.3	N/A	0

*** NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA021 when accessing the WebDCS system.