



Preliminary Information

PIP5732A 2014 2015 Spark M4M CVT7 DTCs Setting After Transmission Replacement.

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Spark	2014 - 2015	All	All	LL0	M4M

Involved Region or Country	North America
Condition	<p>Technicians may find DTCs set after transmission replacement.</p> <p>Research has found the most common codes that could set after transmission replacement are P0796, P0797, P0841, P0863, P0961, P0965 or P2714 but other codes may set.</p> <p>Note: P1790 will always set after the transmission is replaced. Please refer to SI for information on how to address this code.</p>
Cause	<p>It has been discovered that when removing the transmission connector from the transmission and temporarily relocating the wiring harness to allow removal of the transmission the TCM X2 connector may crack and cause wiring and connection concerns.</p>

Correction:

Note: Do not replace the transmission for any DTCs setting right after the transmission has been replaced.

If root cause of the DTCs setting after transmission replacement is not found using SI diagnostics replace the TCM X2 connector and install all new terminated leads.

Parts Information

Description	Part Number	QTY
Terminated Lead Type I	13587509	4
Terminated Lead Type II	19301838	16
Service Connector	19301830	1

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
-----------------	-------------	------------

5430880	Connector with Leads Assembly Replacement Connector with Leads Assembly Replacement	Use published labor time.
---------	---	---------------------------

Version History

Version	2
Modified	06/08/2020 - Created on. 05/25/2021 - Added DTC P0796.



© 2021 General Motors. All Rights Reserved.