



**NUMBER:** 08-084-21

**GROUP:** 08 - Electrical

**DATE:** May 15, 2021

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**SUBJECT:**

Flash: Body Control Module (BCM) Updates

**OVERVIEW:**

This bulletin involves reprogramming the BCM with the latest available software.

**MODELS:**

2020

(FD)

FIAT 500X

**NOTE:** This bulletin applies to vehicles within the following markets/countries: North America.

**NOTE:** This bulletin applies to vehicles equipped with Bi-Function LED Projector Headlamps (Sales Code LM6 ).

**SYMPTOM/CONDITION:**

Customers may notice the following:

- Message on the Instrument Panel Cluster (IPC) - "Headlamp (low beam) Is Out" but the headlamps are all functioning properly.

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If Diagnostic trouble Codes (DTCs) or symptom conditions, other than the ones listed are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition listed above, perform the Repair Procedure.

**REPAIR PROCEDURE:**

**NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted.**

1. Reprogram the BCM with the latest software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.

**NOTE: Have the vehicle's PIN# (SKIM CODE) available before running the Restore Vehicle Configuration routine.**

2. Perform the "Restore vehicle configuration" routine using wiTECH, located under the 'Misc. Functions Tab' of the BCM Module.
3. Clear all DTCs that may have been set in any module due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Skill Category	Amount
18-19-02-GF	Module, Body Control (BCM) - Reprogram (Includes Restore Vehicle Configuration and PROXI Align) (0 - Introduction)	6 - Electrical And Body Systems	0.3 Hrs.

**NOTE: The expected completion time for the flash download portion of this procedure is approximately 4 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.**

**FAILURE CODE:**

**The dealer must use failure code CC with this Service Bulletin.**

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used.
- When utilizing this failure code, the 3C's (customer's concern, cause and correction) must be provided for processing Service Bulletin flash/reprogramming conditions.

CC	Customer Concern
----	------------------