



ROADSTER Accessory Port Power Supply Issue - Possible Inverted Wires at Vehicle Connector_138823

[Printable Version](#)

Rate This Article

(Average Rating: No Rating)

[Version 1](#)Language English ▼[Show Properties](#)

Summary:

Type:

General

TST Detail:

Problem:

- Possible inverted wires at the vehicle accessory port
- Functionality issue with GPS support kit 219400992 and the LED Floorboard lights kit 219401038

Affected units

YEAR	MODEL
2018 and newer	Spyder F3 T and F3 Limited
2020 and 2021 built before January 2021	Spyder RT Series



Solution:

- Inspect the connector for correct wire position


Procedure:

1. Access the accessory connector


- **Spyder F3**

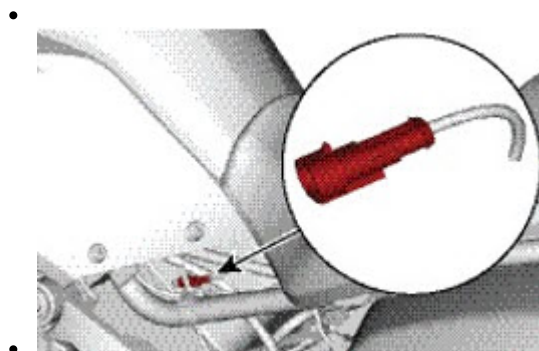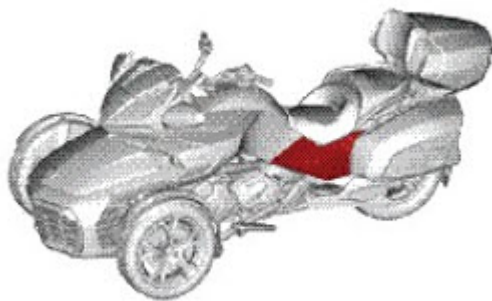

- **Spyder RT**

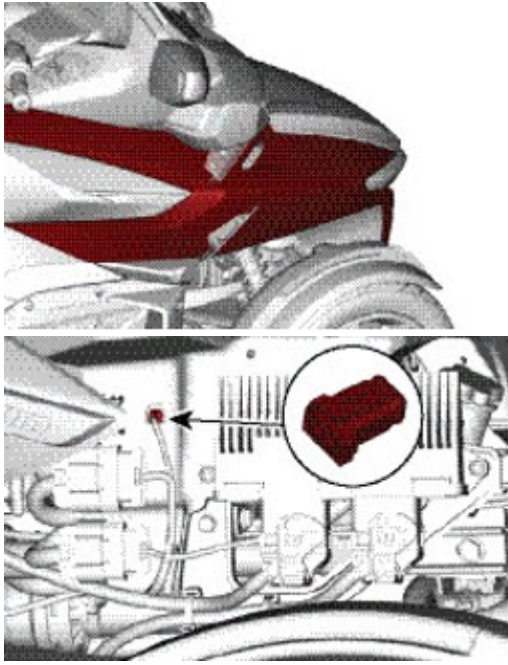

2. Make sure that the black wire on the male connector is on the same side as the female connector

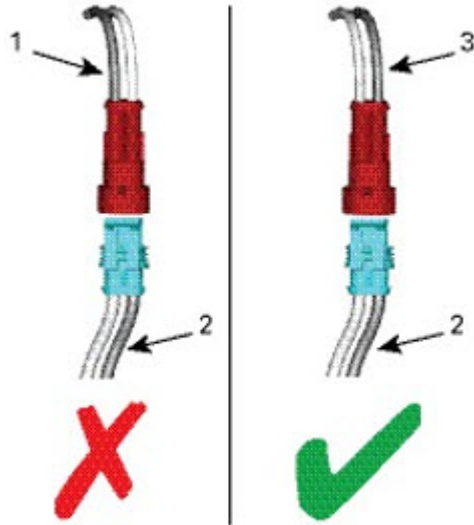

- 1. Black wire on female connector at the wrong location
- 2. Black wire on male connector
- 3. Black wire on female connector at the appropriate location

Attachment:

First Published By: Marc-Antoine Gagnon on 2021-06-28
Last Modified By: Marc-Antoine Gagnon on 2021-06-28