

45-062 - Model 520 PX-9 Oil Pan Leak

6/22/2021

[Edit](#) [Clone](#)

45-062

Section

Engine - 45

Subject

Model 520 PX-9 Oil Pan Leak

Date

6/21/2021

Whats New Abstract

Fix-As-Fail – PX9 oil pan may leak due to improper hardware. Revised hardware will resolve the leak.

Condition

Incorrect battery cable hardware causes oil pan leak.

Chassis Affected

Model 520 chassis with PX-9 engine and a build date from 07/16/2018 through 07/08/2020.

Action

Fix-As-Fail

If a customer comes into your dealership and demonstrates the condition above, use the indicated procedure below.

Warranty

Through Standard Warranty or any applicable active Extended Warranty, Peterbilt will pay for parts at dealer net plus applicable mark-up and labor:

- 0.7 hours labor to remove the battery cable bracket and reroute the battery cables. Use Quick Claim code 45-062.
- File an additional claim for extraordinary circumstances. A quick claim for standard labor must be filed first.

PRWS CLAIM CODING			
Campaign Code:	N/A	Campaign Type:	Field Repair
Claim Category:	Engine	Repair Type:	Fix-As-Fail
Customer Concern Code:	141	Causal Code:	18
Corrective Action Code:	25	Responsibility Code:	Camp
Failure Location:	045-013-001	Causal Part:	P11-6269-002
Supplier Code:	N/A	SRT Code:	032-008 0.7 labor hours- removal of battery cable bracket & rerouting of battery cable

CLAIM CODING			
Failure Location:	045-013-001	Work Accomplished:	69
Failure Type:	220	Responsibility Code:	01
SRT Code:	032-008 0.7 labor hours-removal of battery cable bracket & rerouting of battery cable	Claim Type:	N

Parts

Parts are available from PACCAR Parts.

Quantity	Part Number	Description
4	Source Locally	Cable Clamp/Separator
2	Source Locally	3.5" 6mm Bolt
4	Source Locally	6mm Washer
2	Source Locally	6mm Nylon Insert Nut
2	K028-2489-16	90 Degree Bracket
6	Source Locally	Large Cable Ties

Procedure

Please follow your dealership's safety procedures and precautions to ensure the vehicle can be safely repaired and maintained.

See Attached Procedure Below

Attachments

[Battery Cable Bracket Removal/Reroute Procedure](#)