




Volvo Chassis - Model VNL, VNR - DEF Fill Door Loose, Vibrating, Broken - Repair Information





> Internal Content

On certain VNL and VNR model Volvos built [August 21st, 2017 through January 01, 2021](#) and equipped with chassis fairing p/n 84744212 or 84744213, the DEF fill door in the fairing may become loose or break. A new magnet plate has been introduced to address this issue. The previous style plate Volvo p/n 84744218 comes installed in fairing p/n 84744212 or 84744213 and will have to be removed by drilling out the rivets. The new plate will then be riveted into place.

Door hinge assembly slides into the backside of the door panel and is secured with 2 fasteners at the top

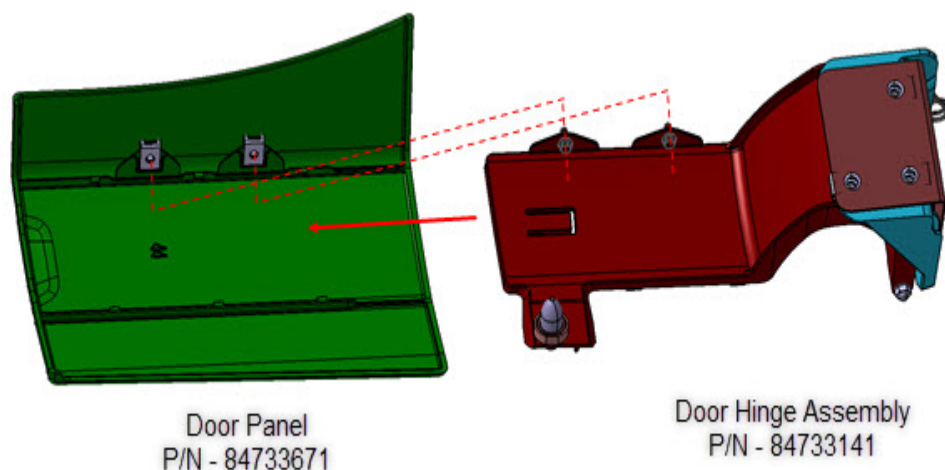

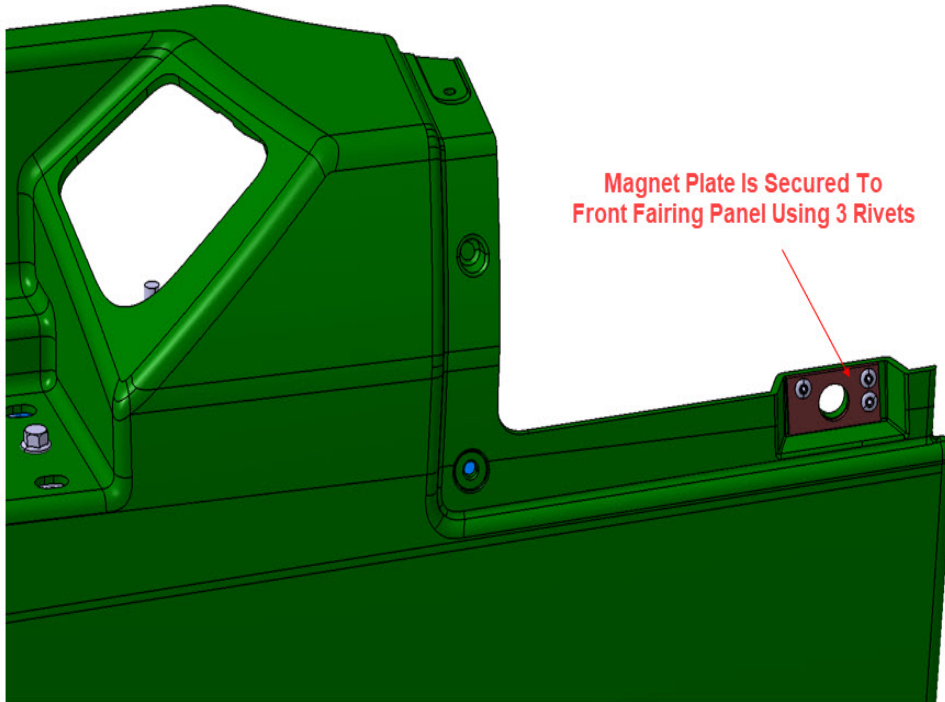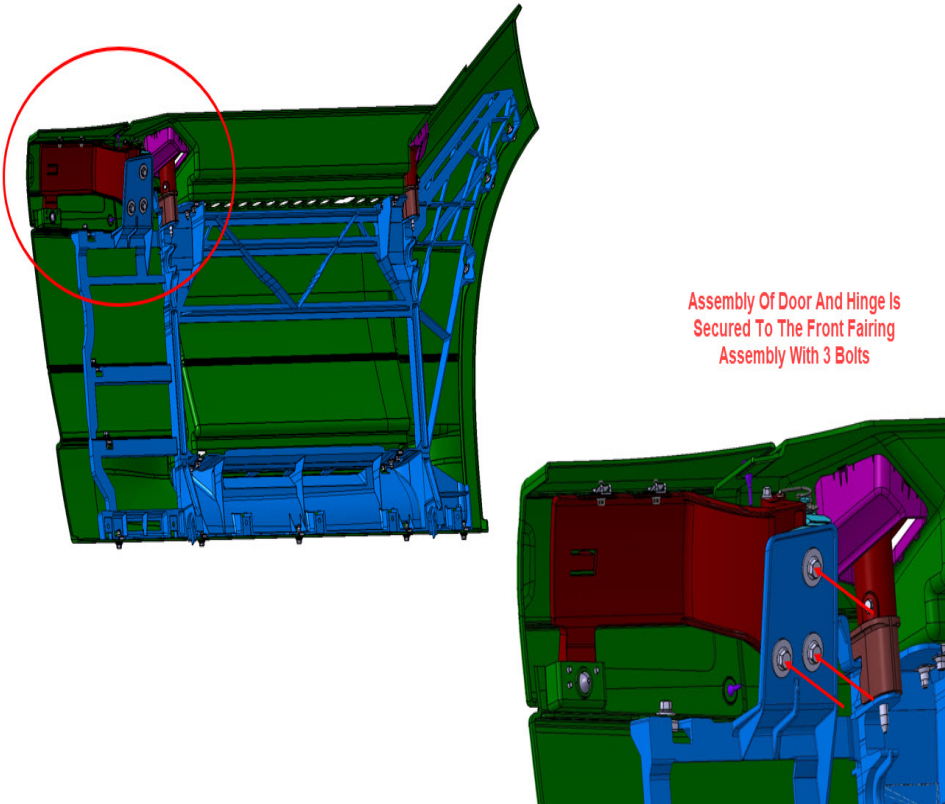

Tags

Supplies Required		
def door	esl	vibrate
volvo	magnet	loose P/N
Rivet	973884	
Drill Bit	3/16"	
Magnet Plate Bracket	78608216	84744218

Front Fairing Description

Previous P/NUpdated P/N

Related links and attachments

No links or attachments available

Feedback



[Give feedback](#)

to help improve the content of this article