



## SIB 51 11 21 ROOF TRIM STRIP LOOSE AT REAR

2021-05-19

### MODEL

E-Series	Model Description	Production Date
G82	M4 Coupe	November 12, 2020- May 28, 2021

### SITUATION



The roof trim strip may be loose at the last (rearmost) clip as shown.

This can occur on either side of the roof, or on both sides.

### CAUSE

Tension on the roof strip caused by a foam support block.

### CORRECTION

Remove the foam block and reinstall the roof trim strip.

### PROCEDURE

1. Remove the roof trim strip following repair instructions REP 51 13 280 "Removing and installing left or right roof trim strip".



2. Remove and discard the foam support block (1).

3. Reinstall the roof trim strip.

Note: If the roof trim strip is replaced in the future for any reason, the foam block must be removed before installing the new part.

### PARTS INFORMATION

Parts are not required.

## WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

<b>Defect Code:</b>	<b>5113194100</b>	<b>Roof trim strip Poorly adapted/fitted</b>
---------------------	-------------------	--

### Repairing one side

Labor Operation	Description	Labor Allowance
51 13 280	Removing and installing <b>left or right</b> roof trim strip (Main work)	Refer to AIR
Or:		
51 13 780	Removing and installing <b>left or right</b> roof trim strip (Plus work)	Refer to AIR

If you are using a Main labor code for another repair, use the Plus code labor operation 51 13 780 instead of 51 13 280.

Or:

### Repairing both sides

Labor Operation	Description	Labor Allowance
51 13 281	Removing and installing <b>both</b> roof trim strips (Main work)	Refer to AIR
Or:		
51 13 781	Removing and installing <b>both</b> roof trim strips (Plus work)	Refer to AIR

If you are using a Main labor code for another repair, use the Plus code labor operation 51 13 781 instead of 51 13 281.

Refer to AIR for the corresponding flat rate unit (FRU) allowances.

Based on which one applies to your center, please refer to **SI B01 01 20** or **B01 07 20** for claiming your diagnosis work time, job/repair work time (WT), RO/Claim WT and/or repair explanation procedures, unless otherwise required by State law.

## QUESTIONS REGARDING THIS BULLETIN

Technical inquiries	Submit feedback at the top of this bulletin
Warranty inquiries	Please contact the Warranty department by either using the Live Chat that's available in the Warranty Documentation Portal or through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections
Parts inquiries	Submit an IDS ticket to the Parts Department