

Type: Customer Satisfaction Campaign

Year: 2021

System: (70) Body

Sequence: 01

MODEL: Revero GT and GS-6**TITLE: Vehicle Recovery Cap Retention Remedy****PURPOSE:** A service tip for loose a recovery cap on the front fascia.

On inspection a Revero GT and GTS or GS-6 this communication will provide a solution to increase the fastening tension of the vehicle recovery cap. The cap may be missing or have been previously replaced. If the cap is still secured remove it as instructed in this bulletin. see the VIN list in this document to verify the vehicle has had this remedy applied.


Should the vehicle be presented without a cap inspect the Front fascia from the underside, as the cap may have fallen into the area. When retrieved, follow the directions below to secure the part. If the part is not found, order part C131172800302 as needed from Karma Automotive.

Place a temporary piece of tape as an anchor on the cap as shown in (Fig 1).

Apply pressure to the bottom portion of the cap to pop it out (Fig 2).

As the cap rotates (Fig 3) use the tape to assist in guiding the cap out to remove safely from the front fascia the remove the recovery cap.

Set the cap on a clean surface and remove the anchoring tape.

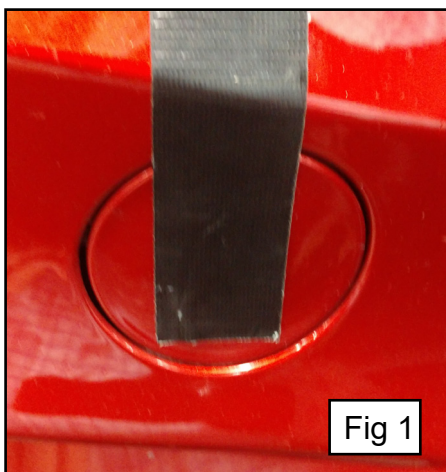

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to an Authorized Karma Service Provider or qualified service center. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Service Provider that the bulletin you intend to use contains the latest available information.

Type: Customer Satisfaction Campaign

Year: 2021

System: (70) Body

Sequence: 01

MODEL: Revero GT and GS-6

TITLE: Vehicle Recovery Cap Retention Remedy

Use a felt tape for the following procedure.

Source this locally, felt wire loom tape if none is available. This is available on-line and at most auto parts stores (Fig 4a and Fig 4b).



Fig 4a

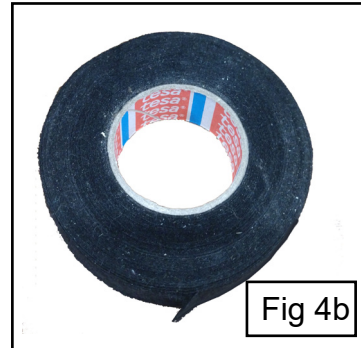


Fig 4b

The existing or new cover (fig 5a and fig 5b) will now have the tabs wrapped with the felt tape.

Cut small strips to wrap these tabs neatly providing one or two layers of the tape on each tab (fig 6a and fig 6b). This should not be too thick so as to cause too great an effort on installation. Installation is the reverse of removal.

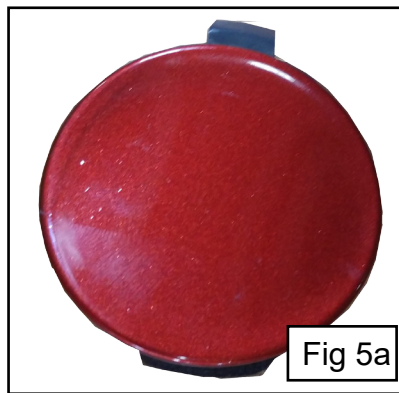


Fig 5a



Fig 5b

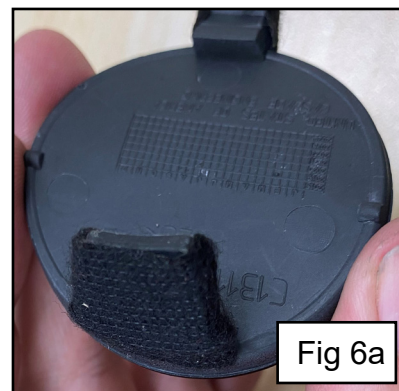


Fig 6a

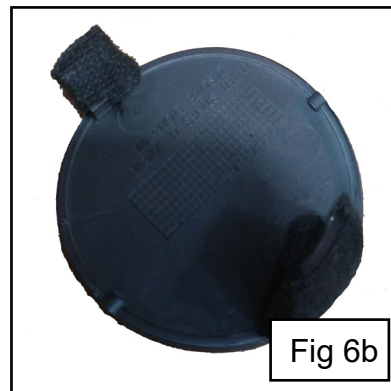


Fig 6b

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to an Authorized Karma Service Provider or qualified service center. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Service Provider that the bulletin you intend to use contains the latest available information.

Applicable Vehicle list MY20

50GK43SB5LA000011	50GK43SB8LA000049	50GK43SB9LA000089	50GK43SB2LA000130
50GK43SB4LA000002	50GK43SB4LA000050	50GK43SB5LA000090	50GK43SB4LA000131
50GK43SB3LA000010	50GK43SB6LA000051	50GK43SB7LA000091	50GK43SB6LA000132
50GK43SB7LA000012	50GK43SB8LA000052	50GK43SB9LA000092	50GK43SB8LA000133
50GK43SB9LA000013	50GK43SBXLA000053	50GK43SB0LA000093	50GK43SBXLA000134
50GK43SB0LA000014	50GK43SB1LA000054	50GK43SB2LA000094	50GK43SB1LA000135
50GK43SB2LA000015	50GK43SB3LA000055	50GK43SB4LA000095	50GK43SB3LA000136
50GK43SB4LA000016	50GK43SB5LA000056	50GK43SB6LA000096	50GK43SB5LA000137
50GK43SB6LA000017	50GK43SB7LA000057	50GK43SB8LA000097	50GK43SB7LA000138
50GK43SB8LA000018	50GK43SB9LA000058	50GK43SBXLA000098	50GK43SB9LA000139
50GK43SBXLA000019	50GK43SB0LA000059	50GK43SB1LA000099	50GK43SB5LA000140
50GK43SB6LA000020	50GK43SB7LA000060	50GK43SB4LA000100	50GK43SB7LA000141
50GK43SB8LA000021	50GK43SB9LA000061	50GK43SB6LA000101	50GK43SB9LA000142
50GK43SBXLA000022	50GK43SB0LA000062	50GK43SB8LA000102	50GK43SB0LA000143
50GK43SB1LA000023	50GK43SB2LA000063	50GK43SBXLA000103	50GK43SB2LA000144
50GK43SB3LA000024	50GK43SB4LA000064	50GK43SB1LA000104	50GK43SB4LA000145
50GK43SB5LA000025	50GK43SB6LA000065	50GK43SB3LA000105	50GK43SB6LA000146
50GK43SB7LA000026	50GK43SB8LA000066	50GK43SB5LA000106	50GK43SB8LA000147
50GK43SB9LA000027	50GK43SBXLA000067	50GK43SB7LA000107	50GK43SBXLA000148
50GK43SB0LA000028	50GK43SB1LA000068	50GK43SB9LA000108	50GK43SB1LA000149
50GK43SB2LA000029	50GK43SB3LA000069	50GK43SB0LA000109	50GK43SB8LA000150
50GK43SB9LA000030	50GK43SBXLA000070	50GK43SB7LA000110	50GK43SBXLA000151
50GK43SB0LA000031	50GK43SB1LA000071	50GK43SB9LA000111	50GK43SB1LA000152
50GK43SB2LA000032	50GK43SB3LA000072	50GK43SB0LA000112	50GK43SB3LA000153
50GK43SB4LA000033	50GK43SB5LA000073	50GK43SB2LA000113	50GK43SB5LA000154
50GK43SB6LA000034	50GK43SB7LA000074	50GK43SB4LA000114	50GK43SB7LA000155
50GK43SB8LA000035	50GK43SB9LA000075	50GK43SB6LA000115	50GK43SB0LA000157
50GK43SBXLA000036	50GK43SB0LA000076	50GK43SB8LA000116	50GK43SB2LA000161
50GK43SB1LA000037	50GK43SB2LA000077	50GK43SBXLA000117	50GK43SB4LA000162
50GK43SB3LA000038	50GK43SB4LA000078	50GK43SB1LA000118	50GK43SB6LA000163
50GK43SB5LA000039	50GK43SB6LA000079	50GK43SBXLA000120	50GK43SB8LA000164
50GK43SB1LA000040	50GK43SB2LA000080	50GK43SB1LA000121	50GK43SBXLA000165
50GK43SB3LA000041	50GK43SB4LA000081	50GK43SB3LA000122	50GK43SB1LA000166
50GK43SB5LA000042	50GK43SB6LA000082	50GK43SB5LA000123	50GK43SB7LA000169
50GK43SB7LA000043	50GK43SB8LA000083	50GK43SB7LA000124	50GK43SB3LA000170
50GK43SB9LA000044	50GK43SBXLA000084	50GK43SB9LA000125	50GK43SB9LA000173
50GK43SB0LA000045	50GK43SB1LA000085	50GK43SB0LA000126	50GK43SB4LA000176
50GK43SB2LA000046	50GK43SB3LA000086	50GK43SB2LA000127	
50GK43SB4LA000047	50GK43SB5LA000087	50GK43SB4LA000128	
50GK43SB6LA000048	50GK43SB7LA000088	50GK43SB6LA000129	

Applicable Vehicle list MY21

50G6E4SS5MA000001	50G6E4SB0MA000021	50GK43SB4MA000180
50G6E4SS7MA000002	50G6E4SL1MA000022	50GK43SB6MA000181
50G6E4SS9MA000003	50G6E4SS6MA000024	50GK43SBXMA000183
50G6E4SS0MA000004	50G6E4SS8MA000025	50GK43SB1MA000184
50G6E4SS2MA000005	50G6E4SSXMA000026	50GK43SB3MA000185
50G6E4SS4MA000006	50G6E4SS1MA000027	50GK43SB5MA000186
50G6E4SS6MA000007	50G6E4SS3MA000028	50GK43SB7MA000187
50G6E4SS8MA000008	50G6E4SS5MA000029	50GK43SB9MA000188
50G6E4SSXMA000009	50G6E4SS1MA000030	50GK43SB0MA000189
50G6E4SS6MA000010	50G6E4SS3MA000031	50GK43SB7MA000190
50G6E4SS8MA000011	50G6E4SS5MA000032	50GK43SB9MA000191
50G6E4SSXMA000012	50G6E4SS7MA000033	50GK43SB0MA000192
50G6E4SS1MA000013	50G6E4SS9MA000034	50GK43SB2MA000193
50G6E4SS3MA000014	50G6E4SLXMA000035	50GK43SB4MA000194
50G6E4SS5MA000015	50G6E4SS2MA000036	50GK43SB6MA000195
50G6E4SS7MA000016	50G6E4SS4MA000037	50GK43SB8MA000196
50G6E4SS9MA000017	50G6E4SS4MA000040	50GK43SB6MA000200
50G6E4SS0MA000018	50G6E4SS6MA000041	50GK43SB8MA000201
50G6E4SB2MA000019	50G6E4SS1MA000044	50GK43SBXMA000202
50G6E4SB9MA000020	50G6E4SS7MA000047	

Type: Customer Satisfaction Campaign

Year: 2021

MODEL: Revero GT and GS-6

System: (70) Body

Sequence: 01

TITLE: Vehicle Recovery Cap Retention Remedy

PARTS REQUIRED:

PART NUMBER	DESCRIPTION	QTY
N/A	N/A	N/A

SHOP SUPPLIES:

DESCRIPTION
Source locally: wire loom harness tape (recommended Tesa)

SPECIAL TOOLS and PARTS:

PART NUMBER	DESCRIPTION	QTY
N/A		

LABOR CODES:

CODE	DESCRIPTION	TIME	DEFECT CODE
70-20-21-05	Recovery Cap Reinstall with Support	0.4	70-20-21-11

SUBLET: (if paint is required for a new recovery cap)

CODE	DESCRIPTION	AMOUNT
PAI	Paint	N/A

CAUSAL PART:

PART NUMBER	DESCRIPTION
C131172800302	Cap - Vehicle Recovery

WARRANTY DISPOSITION:

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to an Authorized Karma Service Provider or qualified service center. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Service Provider that the bulletin you intend to use contains the latest available information.