


TECHNICAL TOPICS

BODY/CHASSIS



Deployable Exterior Door Handles	21MY I-PACE, RR Velar, RR Evoque
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none">- A customer may report that the exterior door handle does not fully retract in the flush position in freezing temperatures. (This does not affect door latch operation.) <p><u>Technical Description:</u></p> <ul style="list-style-type: none">- TSB JLRTB02041NAS3 has been published to address this concern. Please note: all 4 door handles should only be replaced when the criteria of the TSB is met. <p><u>Status:</u></p> <ul style="list-style-type: none">- The door issue related to this TSB has been addressed in production at the following VINs: RR Velar = MA301206, RR Evoque = MH131144 and I-PACE = M1613540.- Door handles built after the assured VINs should not be replaced unless the guided flow diagnostics leads to this change.- The guided flow for door entry system 9360 is now live and includes deployable handles.	 <p>The image shows a close-up of a blue door handle on a dark grey door. The handle is not fully retracted into the door panel. A white callout box with a blue background and white text points to the handle with the text "Not retracted flush". The image is framed with a white border and has a magnifying glass icon in the top left corner. The text "E205614" is visible in the bottom left corner of the image frame.</p>

