



HYUNDAI Technical Service Bulletin

GROUP Body	NUMBER 21-BD-003H
DATE June, 2021	MODEL(S) Palisade (LX2)

SUBJECT: WIND/WHISTLING NOISE FROM DOOR GLASS AREA

This TSB supersedes TSB# 19-BD-010H by updating the service procedure, parts information, and warranty information.

Description: This bulletin describes the procedure to replace the inside belt molding and attach pads to the side view mirror seal, side view mirror hole, and glass run on certain Palisade vehicles experiencing wind and/or whistling noise while driving.

Applicable Vehicles: Certain 2020 – 2021MY Palisade (LX2) vehicles

Parts Information:

PART NAME	PART NUMBER	FIGURE	APPLICABLE PRODUCTION DATE
Inside belt molding	82231-S8000FFF		Before 2/2/2020
Glass run pad	82532-S8000FFF		Before 12/23/2019
Glass run clip	82259-S1001FFF		Before 12/23/2019
Side view mirror base pad	87635-S8000FFF		Before 4/20/2020
Side view mirror hole pad	87635-S8100FFF		Before 9/28/2020

Note: Refer to the vehicle's production date to determine which part(s) to replace. DO NOT replace the part(s) if the vehicle's production date is after date in the "Applicable Date" section.

Warranty Information:

MODEL	OP CODE	OPERATION	OP TIME	CAUSAL PART	NATURE CODE	CAUSE CODE
Palisade (LX2)	87635F00	INBELT REPLACEMENT	0.3M/H	82231-S8000FFF	Q55	ZZ2
	87635F01	GLASS RUN PAD ATTACHMENT AND FASTENER REPLACEMENT	0.3M/H	82532-S8000FFF		
	87635F02	OUTSIDE MIRROR PAD ATTACHMENT	0.4M/H	87635-S8000FFF		
	87635F03	OUTSIDE MIRROR HOLE PAD ATTACHMENT	0.5M/H	87635-S8100FFF		
	87635F04	INBELT, GLASS RUN PAD, OUTSIDE MIRROR PAD/HOLE PAD	0.9M/H	82231-S8000FFF		

Note: Normal warranty applies.

Service Procedure:

A. Inside Belt Molding Replacement


1. Refer to the shop manual to remove the front door trim.



NOTICE

This section only applies for vehicles built before 2/2/2020.

2. Remove and replace the inside belt molding (A).

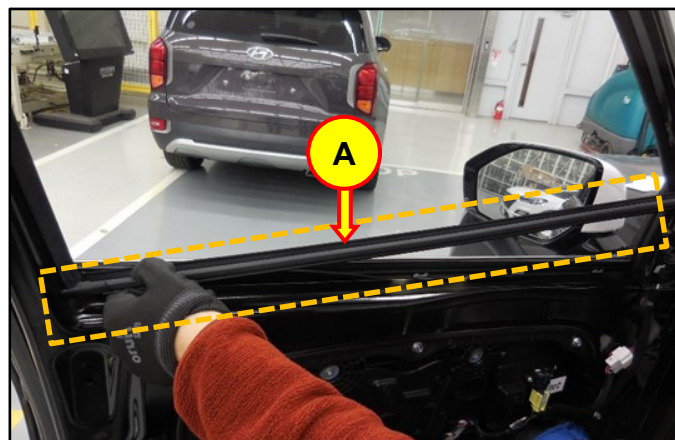

B. Side View Mirror Base Pad Attachment


1. Refer to the shop manual to remove the side view mirror.



NOTICE

This section only applies for vehicles built before 4/20/2020.

2. Reinstall the side view mirror seal (B) and remove any contamination.

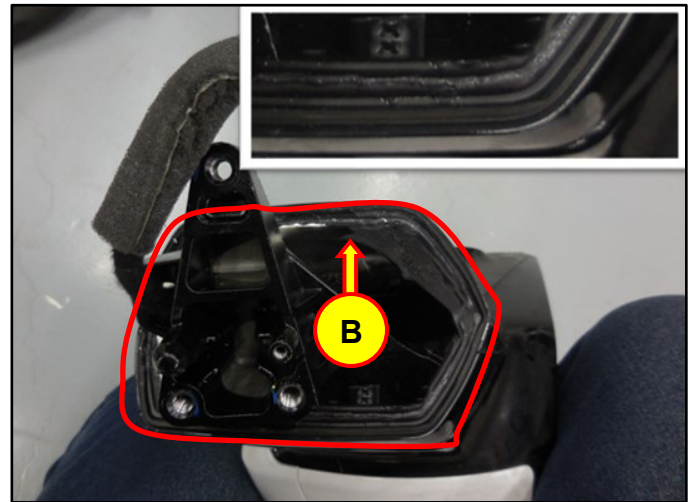


3. Attach the pad to the side view mirror seal.

NOTICE

The pad must not extend beyond the edge of the side view mirror seal.



4. Cut away any part of the pad that extends beyond the side view mirror seal.

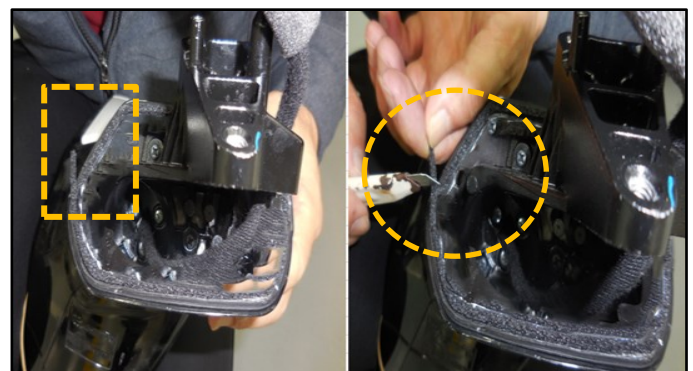

- 5. Reinstall the side view mirror in the reverse order of removal.




- 6. Verify the pad is not visible after reinstalling the side view mirror.



- 7. Repeat steps 1-6 on the opposite side.

C. Side View Mirror Hole Pad Attachment


- 1. Refer to the shop manual to remove the side view mirror.

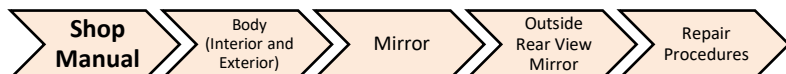


NOTICE

This section only applies for vehicles built before 9/28/2020.


- 2. Remove the side view mirror seal (B).

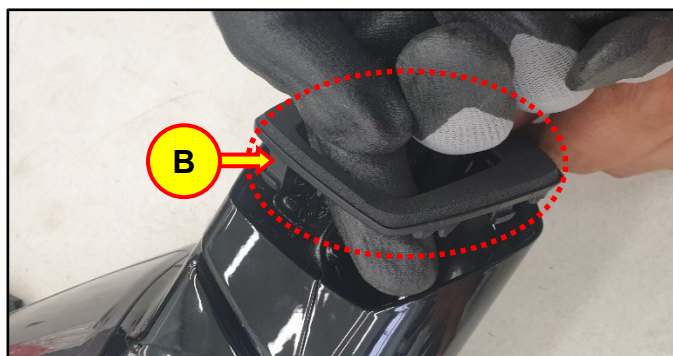

3. Place the foam pad (C) around the wiring harness.

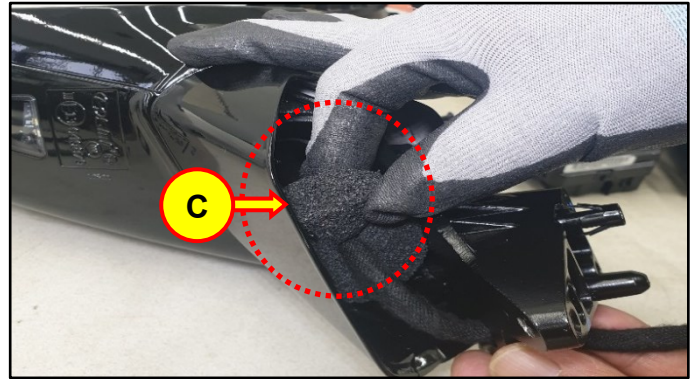

4. Insert the foam pad through the wiring harness hole (D).

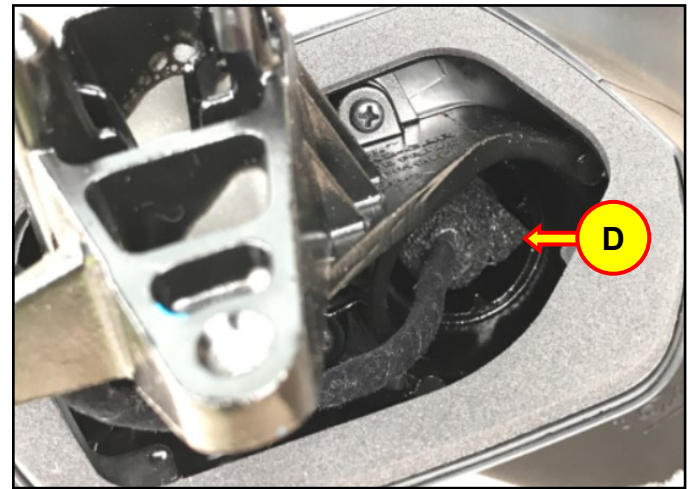

5. Reinstall the side view mirror in the reverse order of removal.



6. Repeat steps 1-5 on the opposite side.

D. Glass Run Pad Attachment


1. Remove the top corner of the front door glass run (C).

NOTICE

This section only applies for vehicles built before 12/23/2019.

NOTICE

Do not completely remove the glass run.


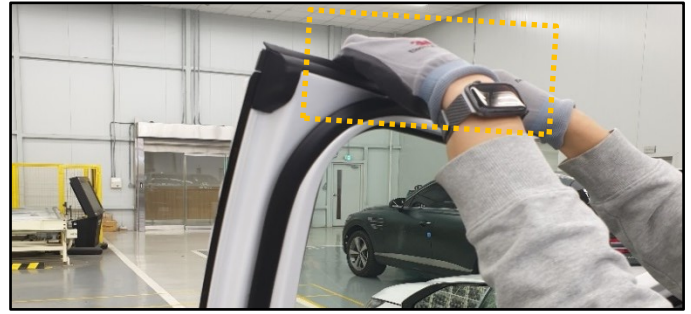


2. Attach the glass run pad (D) as shown in the photos.


NOTICE

Attach the glass run pad directly onto the existing pad.

Align the glass run pad to the rear of the existing pad.

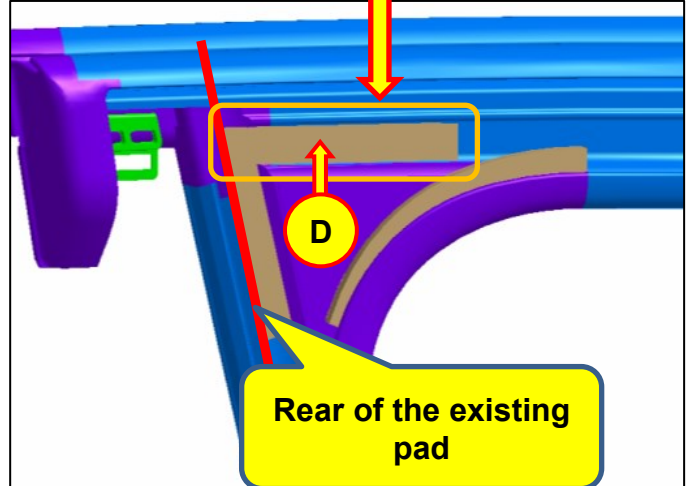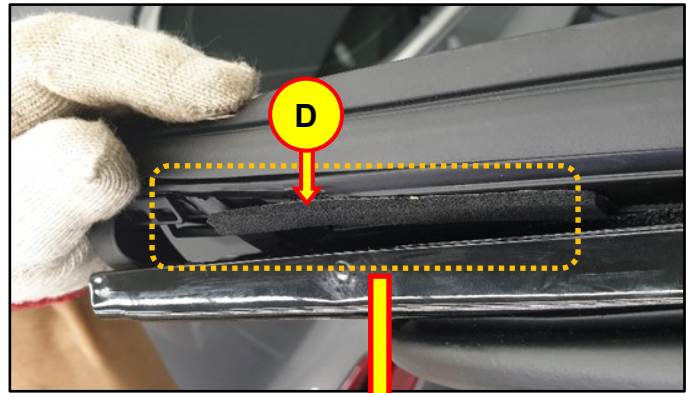

3. Replace the glass run clip (E).

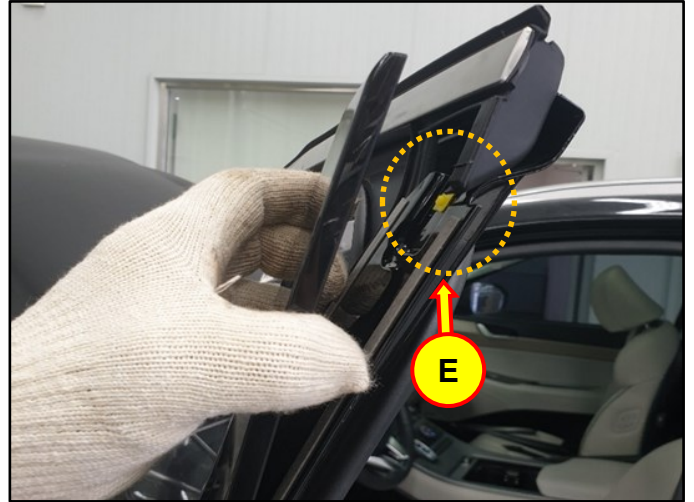

4. Reinstall all removed parts in reverse order of removal.
5. The service procedure is now complete.