

## **SSM 49968 - 2020-2021 Corsair/Nautilus/Navigator/Aviator, 2021 F-150/Mustang Mach-E - Phone-As-A-Key Concerns - Various DTCs In The RFA module**

Some 2020-2021 Corsair/Nautilus/Navigator/Aviator, 2021 F-150/Mustang Mach-E vehicles equipped with Phone-as-a-Key may have diagnostic trouble code(s) (DTC) U200D:15, U200E:15, U200F:15, B15\*\*:31, B15\*\*:49 and/or B15A5:56 stored in the remote function actuator (RFA) module. If any of these DTCs are detected during normal diagnostics, clear the DTCs, reflash RFA to the latest software level and start a new Ford Diagnosis and Repair System (FDRS) session. Verify that DTCs are no longer present. If only the B15\*\*:31, B15\*\*:57 and/or B15A5:56 DTC(s) returns in the RFA after a self test, follow normal Workshop Manual (WSM) diagnostics, Section 419-01C.

### APPLICABLE VEHICLES

2020 - 2021 CAR: TV U611N AVIATOR  
2020 - 2021 CAR: TF CX483N CORSAIR  
2021 TRUCK: FD P702N F150  
2020 - 2021 CAR: D9 U540N MKX  
2021 CAR: GW CX727N C-EV  
2020 - 2021 TRUCK: B9 U554N NAVIGATOR