# Service Alert

## Mazda North American Operations Irvine, CA 92618-2922



Subject:

CONNECTED VEHICLE REMOTE FUNCTIONS INOPERATIVE AND/OR ENGINE NO START DUE TO LOW BATTERY VOLTAGE

Service Alert No.: SA-045/21

Last Issued: 07/23/2021

# **APPLICABLE MODEL(S)/VINS**

2021 Mazda3 vehicles built July 1, 2021 and later

2021 CX30 vehicles built July 1, 2021 and later


2021 CX-5 vehicles built March 19, 2021 and later

2021 CX-9 vehicles built March 19, 2021 and later

#### **DESCRIPTION**

Some customers may expierience the following symptoms:

- · Connected Vehicle Remote Functions inoperative after SSPC6 repair.
- Connected Vehicle Remote Functions inoperative on vehicles built July 1, 2021 and later.
- Engine no start due to low battery voltage.

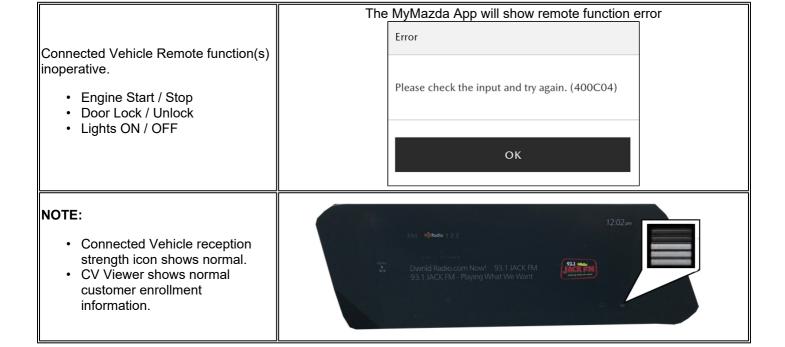

Page **1** of **6** 

Last Issued : 07/23/2021

# **REPAIR PROCEDURE**

Service Alert No.: SA-045/21

#### **Preparation**

- 1. Prepare four (4) individual USB memory sticks and label them as shown in the table.
- 2. Delete all files from the USB memory sticks.
- 3. Download the following files to each individual USB memory stick by model.

| Model  | File Name and Link        | Software Version | USB Memory Stick      |
|--------|---------------------------|------------------|-----------------------|
| Mazda3 | Coming Soon               | 10020            | Mazda 3<br>TC U 10020 |
| CX-30  | Coming Soon               | 10020            | CX-30<br>TCU 10020    |
| CX-5   | TCU_7000T11-0301_8014.kwi | 10020            | CX-5<br>TCU10020      |
| CX-9   | TCU_7000T11-0201_8014.kwi | 10020            | TCV10020              |

### NOTE:

- Each USB memory stick should only have one (1) file on it. If two or more files exist on the USB memory stick, no file is recognized for the reprogramming.
- Advise the customer to NOT use the remote control features (remote engine start/stop, remote door lock/unlock, turn on /off hazard warning lights) with the MyMazda App during the repair. The malfunction information may be sent for the DTC detected during the repair.

### Reprogramming the Telematics Communication Unit (TCU).


- 1. Maintain battery voltage using a the DCA8000 or GR8 battery charger. See SA-034/21.
- 2. Turn the ignition switch to ACC.

**CAUTION:** To avoid damaging the TCU, DO NOT turn the ignition switch to OFF or disconnect the battery terminal during reprogramming.


3. Insert the USB memory stick by model into the USB port located in the center console.

Page 2 of 6

Service Alert No.: SA-045/21 Last Issued : 07/23/2021

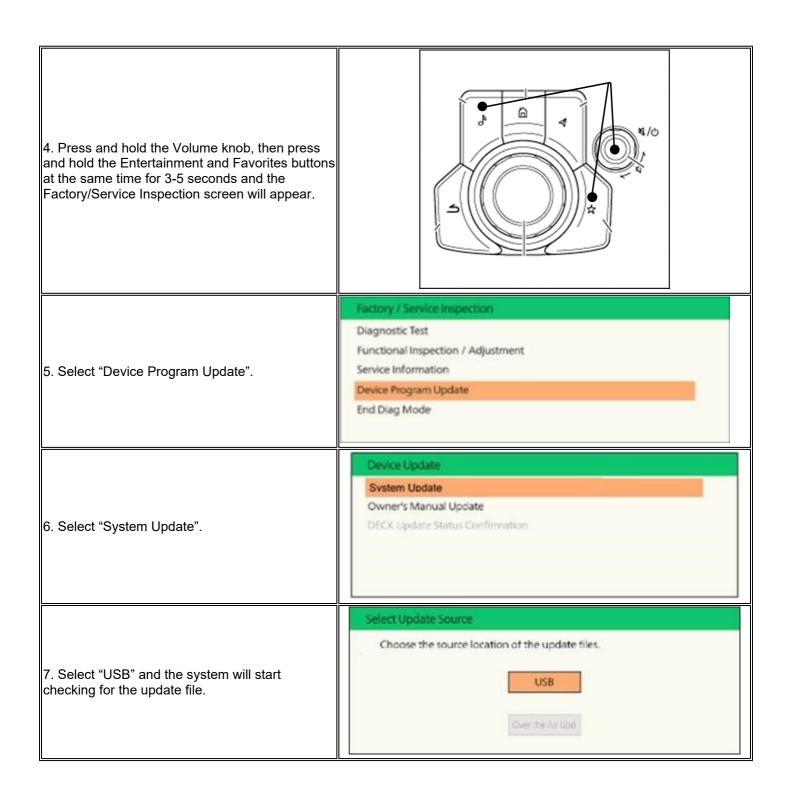


Page 3 of 6

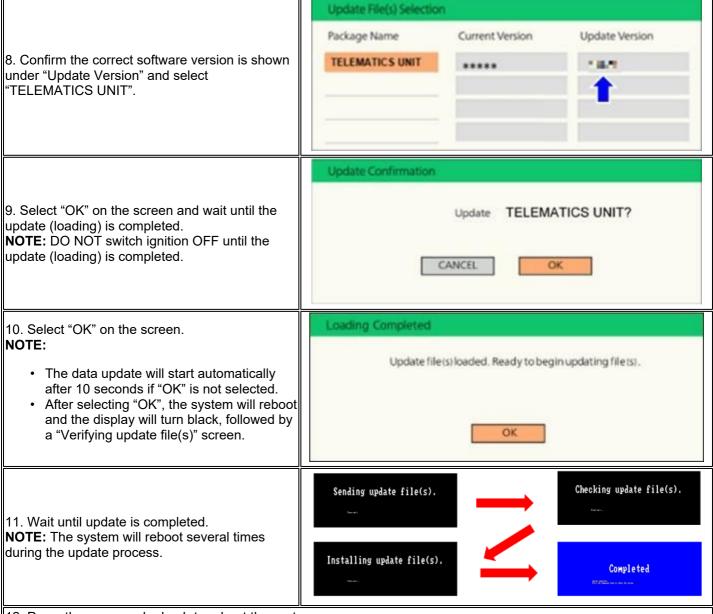

- 12. Press the commander knob to reboot the system.
- 13. After rebooting is completed, remove the USB memory stick from the USB port.
- 14. Same as step 4, move to Factory/Service Inspection screen.
- 15. Select Service Information.

Page 4 of 6

 Service Alert No.: SA-045/21 Last Issued : 07/23/2021



17. Confirm that the TCU software version has been updated.



- 18. Push Return multiple times to return to the top page of Factory/Service Inspection screen, then select End Diag Mode to return to the normal infotainment screen.
- 19. Check for DTCs with the Mazda Modular Diagnostic System (M-MDS) using Mazda Diagnostic And Repair Software (MDARS). If any are present, clear them.

20. Switch the ignition OFF.

Customer is enrolled into connected vehicle services.

At vehicle pickup, use the customer's phone and the MyMazda App to confirm connected vehicle remote functions operate normally.

- · Engine Start / Stop
- · Door Lock / Unlock
- Lights ON / OFF

21. Verify repair.

Customer is not enrolled into connected vehicle services.

Confirm connected vehicle reception strength icon shows good strength.



### WARRANTY INFORMATION

| Warranty Type          | A            |  |
|------------------------|--------------|--|
| Symptom Code           | 64           |  |
| Damage Code            | 9W           |  |
| Part Number Main Cause | 5555-21-005A |  |
| Quantity               | 0            |  |

Page 5 of 6

| Service Alert No.: SA-045/21 | Last Issued : 07/23/2021 |
|------------------------------|--------------------------|
|                              |                          |
|                              |                          |

YY823XRX / 0.4 Hrs

Operation Number / Labor Hours:

Page 6 of 6