

Trunk Hands-Free Access and Keyless-Go inoperative

Topic number	LI80.61-P-072709
Version	2
Function group	80.61 - Keyless-Go/Keyless-Entry
Date	7/1/21
Validity	Model series 223 Maybach and model series 297 EQS
Reason for change	Model series 297 added

Complaint

Trunk lid opening using Hands-free Access and the 'closing and locking' button inside the trunk lid are inoperative.

Cause

The cause may be due to the Keyless-Go antenna in the trunk not being connected.

Important: The follow fault code is Not stored or relevant for this complaint: B1A5113 "The rear LF 'Keyless-Go' antenna has a malfunction. There is an open circuit".

Remedy

Check connector coupling of LF antenna in trunk for correct contacting and reconnect.

Symptoms
Overall vehicle > Safety and locking system > Keyless go > Function > Card not detected
Overall vehicle > Safety and locking system > Keyless go > Function > Vehicle does not open

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note