

Clicking Noise From Front Hub

18 – 21MY RR Velar

Customer Voice:

- A customer may report a clicking type noise from the wheel area at low speeds when turning near full lock.

Technical Description:

- This may be caused by the brake disc to wheel hub flexing/moving during cornering loads allows stick-slip movement of the disc along the wheel hub spigot.

Status:

- **SSM 75409** has been published to address this concern by providing repair guidance to clean and lubricate the front hub spigot.
- There are videos attached to the SSM for reference.



Remove corrosion from wheel hub spigot

Apply- MOLYKOTE® Cu-7439 Plus Paste to wheel hub spigot area as below



PRINTED COPIES ARE UNCONTROLLED