




HYUNDAI Technical Service Bulletin

GROUP Body Electrical	NUMBER 21-BE-009H
DATE July, 2021	MODEL(S) Santa Fe (TMa)

SUBJECT: SANTA FE (TMA) CRASH PAD CENTER SPEAKER REPLACEMENT PROCEDURE

Description: The front center speaker may produce a scratchy or distorted sound during operation. This bulletin describes the procedure to replace the crash pad center speaker for certain 20 and 21MY TMa Santa Fe.

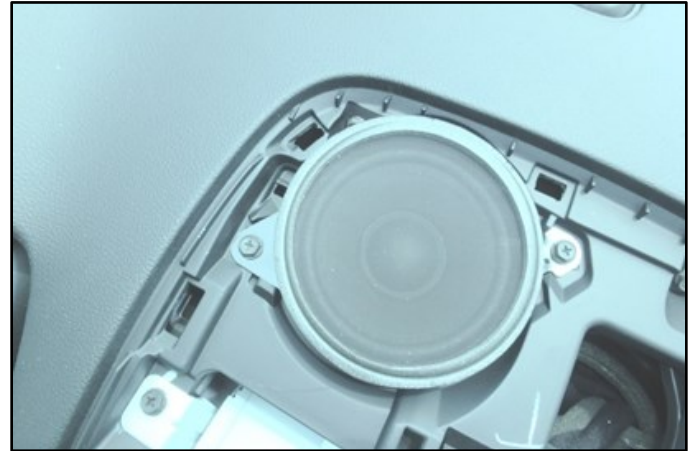

Applicable Vehicles: Certain 2020-2021MY Santa Fe (TMa).

Parts Information:

PART NAME	PART#	QTY
Speaker Assy – Front Center	96350-S1200	1

Warranty Information:

MODEL	OP CODE	OPERATION	OP TIME	CAUSAL PART	NATURE CODE	CAUSE CODE
Santa Fe (TMa)	10DA22R0	Crash Pad Center Speaker Replacement	0.2 M/H	96350-S1200	M43	ZZ3

Note 1: Submit claim on Campaign Claim Entry Screen

Note 2: If part that is not covered by this campaign is found in need of replacement while performing this TSB and the affected part is still under warranty, submit a separate claim using the same Repair Order. If the affected part is out of warranty, submit a Prior Approval Request for goodwill consideration prior to performing the work.

SUBJECT: SANTA FE (TMA) CRASH PAD CENTER SPEAKER REPLACEMENT

Service Procedure:


1. Turn ignition 'OFF'.



2. Using a plastic pry tool, begin the removal at the indicated position where a slot is located for inserting a removal tool.

CAUTION

Use plastic removal tools and clean shop towels to avoid damage to the crash pad surface.

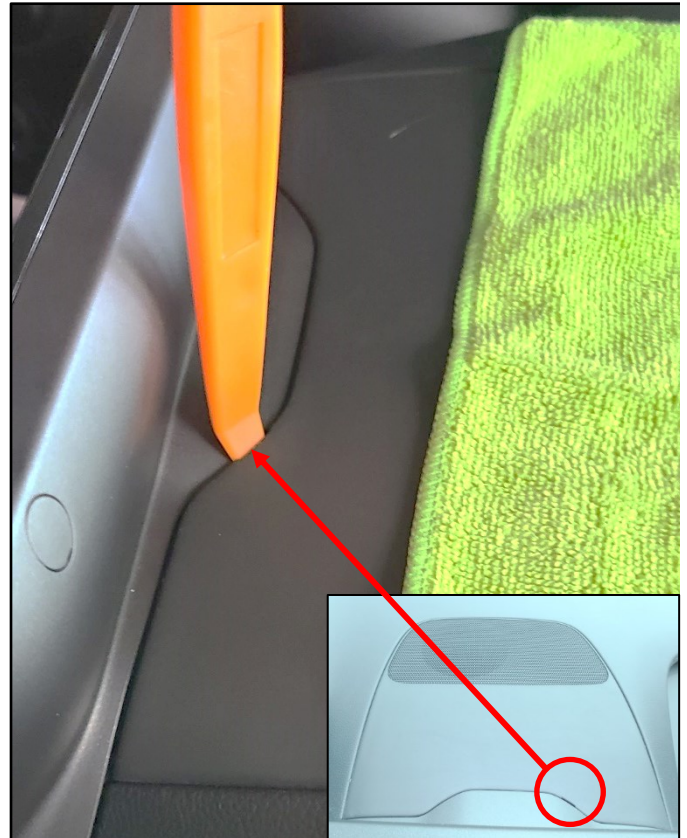

SUBJECT: SANTA FE (TMA) CRASH PAD CENTER SPEAKER REPLACEMENT

- Carefully work the plastic pry tool around the speaker grill until removed.

NOTICE

Use a clean shop towel or microfiber cloth to protect the crash pad while prying.




- Remove the two (2) screws that secure the speaker.


(A, 8mm) and (B, 8mm).

Tightening Torque:

17.7 - 24.5 Nm (1.8 - 2.5kgf.m, 13.0 - 18.1lbf)

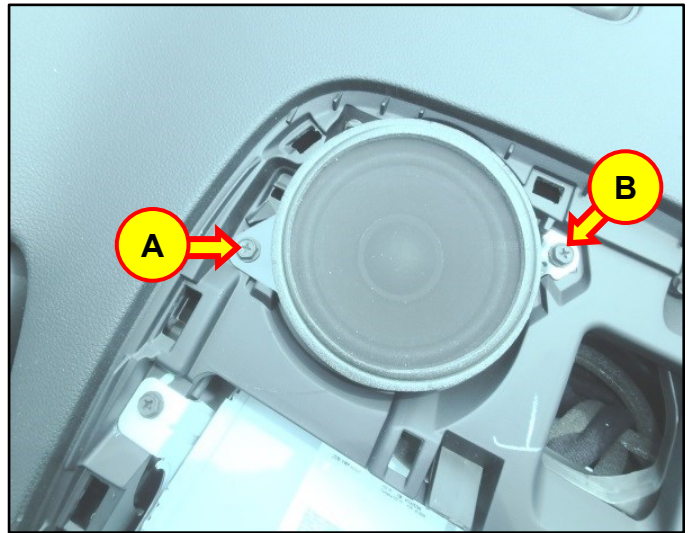

- Disconnect the main wiring harness connector (C) and remove speaker.

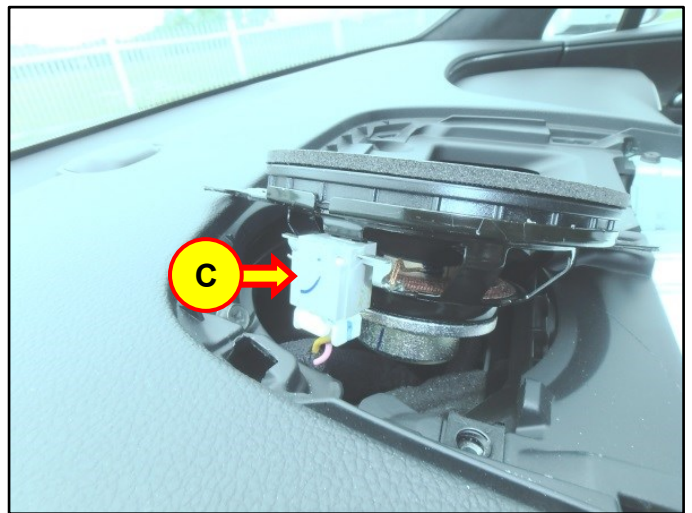

6. Connect new speaker and confirm speaker operates as designed. Once confirmed, reassemble speaker and grill into crash pad.
7. The service procedure is now complete.