



Search all content

DTNA Solutions > Service Solutions > Western Star
> SS 711-WST 2021 49X Aux E-vault Rattle in Day Cab

Options

SS 711-WST 2021 49X Aux E-vault Rattle in Day Cab



Applicable Vehicles

49X day cabs built with aux e-vault

Symptoms


Rattle noise inside of cab coming from the e-vault location

Issue

Mounting bracket has low fore/aft stiffness

Solution


Drill quantity (3) 7.2mm dia hole 12mm deep through both mounting brackets while installed in vehicle per install locations below (additional 7.2mm hole shown below in upper rh corner of the drawing as reference point for dimensions) and add in quantity (3) each M6 bolt 000000 001476 & M6 23-12753-006 clinch nut.

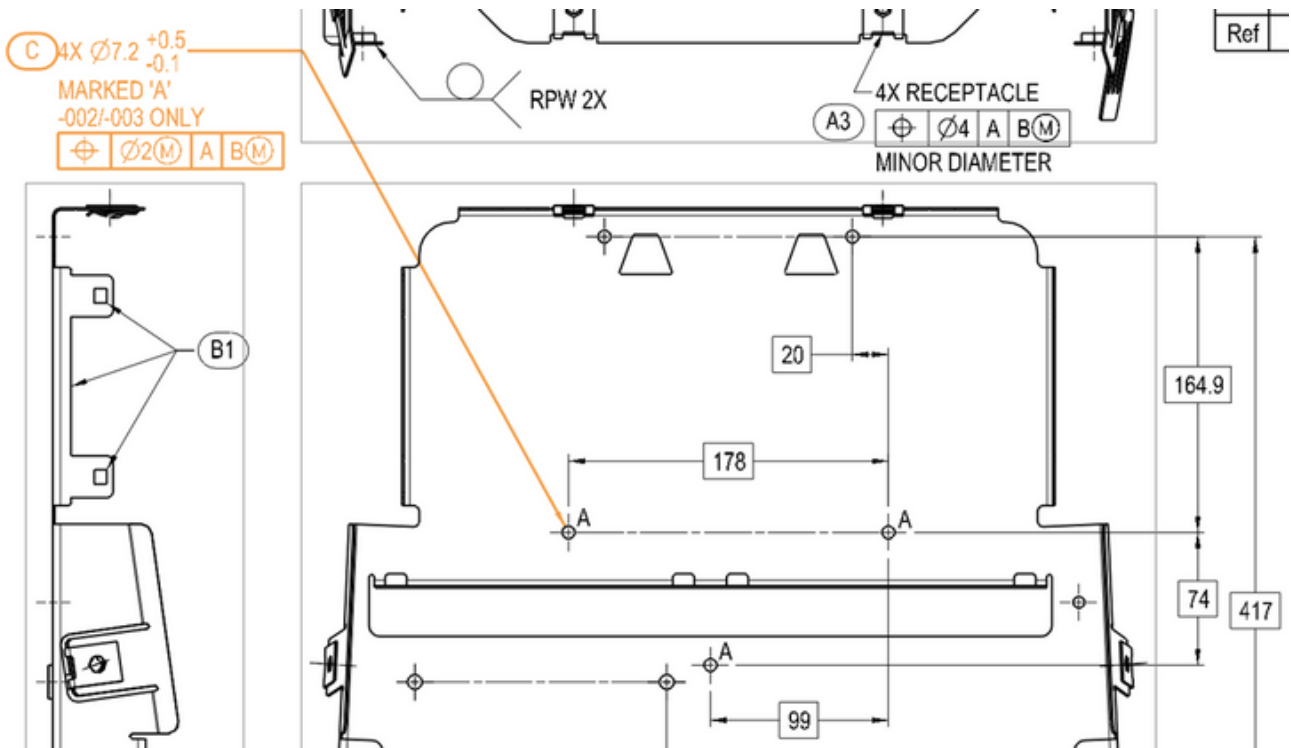

Labels :

49X

Add tags

 0 Kudos

Version history

Last update: 08-27-2021 09:57 AM

Updated by:  Matthew_Bibo

Contributors



Matthew_Bibo



Copyright © Daimler Trucks North America LLC. All rights reserved. Daimler Trucks North America LLC is a Daimler company.

[Privacy Statement](#) • [Legal Notice and Terms](#)