Reference	SSM75469
Models	Discovery Sport / L550
Title	L550 16-22MY Accessory Fit Roof Rail Trim(s)/ Cap(s) Not Correctly Fitted Causing Poor Appearance
Category	Accessories
Last modified	05-Aug-2021 00:00:00
Symptom	General Accessories
Attachments	L550 Roof Rail Caps_Supporting Images.pdf (L550 Roof Rail Caps_Supporting Images.pdf)

Content Issue:

Customers report that the accessory fit roof rail trims/ caps are not correctly fitted, causing a poor cosmetic appearance.

Cause:

Roof rail trim(s)/ cap(s) are not engaged correctly, resulting in broken clips leading to poor cosmetic appearance.

Action:

- VPLCR0146 / FK7M-551B12-AB Black Cap Kit
- VPLCR0147 / FK7M-551B02-BB Silver Cap Kit
- 1. Check all roof rail trim/ caps
- 2. If damaged/ not fitted correctly, please replace the affected trim(s)/ cap(s), using the applicable part number above and following the existing Topix Accessory Fitting Procedure (Carrying > Roof Rails).

Please Note:

- The caps are designed to be Left & Right Handed and of different sizes
- The caps and the holes must be matched before fitting on the rail.
- The caps orientation must be correct before fitting to the rail (arrows to point towards the front of the vehicle)
- They are a one-time fit and should fit tightly onto the roof rail square machined holes when fitted correctly, see the image within the attachment.

Caution:

- Please see attached images of a cap. Make sure the cap's clips are not damaged or bent out of alignment before fitting
- · Excessive force must not be used to fit caps
- Lubricants must not be used to fit caps.

anBhdHRlcnM7MjAyMS0wOC0wNVQxMTo1OToyNS45MzNaOzEzNi4yMjYuNDguMTl3Ow=