

Reference	SSM75499
Models	E-PACE / X540
Title	E-Pace X540 Jaguar Drive Control (JDC) U0028-81 & U0001-87
Category	Driveability
Last modified	05-Aug-2021 00:00:00
Symptom	698298 Malfunction Indicator Lamp

Content

ISSUE:
Customers may report a change of Jaguar Drive Control (JDC) to “Comfort” mode without driver input.

The below Diagnostic Trouble Code (DTC) may be logged:

U0028-81: ‘Vehicle Communication Bus A - invalid serial data received’ stored in the Gateway Module (GWM).

U0001-87: ‘High Speed CAN Communication Bus - missing message’ stored in the Transmission Control Module (TCM)

It may also be reported that specific applications involving the GWM do not complete.

NOTE: GWM software part affected = K9C3-14F530-AA

CAUSE:
The previous software resolved by PATHFINDER is not compatible.

ACTION:
If the 2 DTCs are present and the GWM software is on the above mentioned software part number then please raise a TA for the attention of PTS_160 (Calibration & Controls).

anBhdHRicm7MjAyMS0wOC0wNV0xMT01NTowNS43OTZaOzEzNjYyNDguMTI3Ow==