

SSM 50048 - 2020-2021 Corsair/Aviator/Navigator - Phone As A Key – Unable To Pair Phone To Vehicle With DTC U3000:49 In The RFA Module

Some 2020-2021 Corsair/Aviator/Navigator vehicles may have diagnostic trouble code (DTC) U3000:49 DTC stored in the remote function actuator (RFA) module preventing pairing-connecting any phone as a key to the vehicle. If this DTC is detected during pre-delivery inspection (PDI) or while diagnosing phone as a key pair/connection issue, remove the RFA fuse or disconnect the battery terminals for minimum of 5 minutes then reinstall. Start a new FDRS session and verify that U3000:49 is no longer present. Ensure that phone as a key is enabled and a phone can be paired to the vehicle. If the concern is still present, follow normal diagnostics procedures in Workshop Manual (WSM), Section 419-01C.

APPLICABLE VEHICLES

2020 - 2021 CAR: TV U611N AVIATOR
2020 - 2021 CAR: TF CX483N CORSAIR
2020 - 2021 TRUCK: B9 U554N NAVIGATOR