

Table 2. Software Version

BCM Software	Version
Calibration	13.22.0.2 or later
Application	13.15.0.2 or later

During Predelivery Inspection (PDI), verify that the most up-to-date software is installed. Check software version using DT II. Refer to Table 2.

Special Tool: DIGITAL TECHNICIAN II (PART NUMBER: HD-48650)

Body Control Module (BCM) Reflash Sequence

1. Connect battery tender directly to vehicle battery (not through battery tender lead).
 - a. Verify battery is fully charged before proceeding.
2. Connect TL-3 to vehicle.
3. Connect external power to TL-3 using appropriate power supply providing at least:
 - a. 12 V
 - b. 1.2 A
4. Place vehicle in Accessory mode.
 - a. Press and hold trip button 5 s.
5. Open DT II program and establish communication with vehicle.
6. Proceed to reflash BCM and follow on-screen directions.

Supplemental Procedure Video

⚠ WARNING

Always review the appropriate service procedure prior to performing it. This video is intended to supplement, not replace, documented service procedures. Attempting service procedures without the proper training, tools, equipment, and manuals could result in death or injury to you or others. This could also damage the motorcycle or cause the motorcycle to operate improperly. (10406a)

This video is a supplement of the procedure covered in the document. This video can only be viewed through Service Information Portal (SIP).

1436457



Video 1.

Credit Procedure

NOTE

Enter bulletin number into comment section of claim.

Submit a warranty claim per Table 3 for each vehicle that receives this update.

Table 3.

ITEM	DATA
Claim Type	PRD/MC/DEM
Problem Part Number	41000678
Quantity	Leave Blank
Primary Labor Code ⁽¹⁾	6192
Time	0.2 h
Customer Concern Code	9210
Condition Code	6192
(1) Download may be required	