

2021-07-16



SIB 51 16 21

NOISE FROM THE CENTER CONSOLE GEAR SHIFT COVER

MODEL

E-Series	Model Description	Production Date	Affected option
G80	M3 Sedan	From December 1 st , 2020 to June 30 th , 2021	ZMT- Manual Transmission
G82	M4 Coupe		

SITUATION

Noises from the center console shifter cover at low speeds. The noise can be affected by pressing the gearshift lever knob.

CAUSE

Insufficient noise shielding in the gearshift lever cover.

PROCEDURE



1. Inspect the shifter cover revision index number (AI).

2. If the index number is 03 as shown in the picture, replace shifter cover with revision 04, as per repair instructions **25 11 085**

3. If the index number is already at 04, do not replace shifter cover, and perform further diagnosis.

Important: Gearshift lever covers with AI 04 will enter standard production in June 2021

PARTS INFORMATION

Obtain and confirm the part numbers for your specific vehicle by entering the chassis number in either ETK or AIR which takes into account specific equipment and/or options.

Part Number	Description	Quantity
25 11 8 097 174	Leather shift knob with boot/6-speed	1

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	2511023700	Shift lever cover, manual gearbox Loose
---------------------	-------------------	--

Refer to AIR for the corresponding flat rate unit (FRU) allowance.

Operation	Description	Labor Allowance
25 11 085	Replacing gearshift lever knob and gearshift lever cover (Main work)	Refer to AIR
Or:		
25 11 591	Replacing gearshift lever knob and gearshift lever	Refer to AIR

Copyright ©2021 BMW of North America, Inc.

	cover (Plus work)	
--	-------------------	--

If you are using a Main labor code for another repair, use the Plus code labor operation 25 11 591 instead of 25 11 085.

Based on which one applies to your center, please refer to **SI B01 01 20** or **B01 07 20** for claiming your diagnosis work time, job/repair work time (WT), RO/Claim WT and/or repair explanation procedures, unless otherwise required by State law.

Other Repairs

If other eligible and covered work is performed as a result of performing the ISTA diagnostics and related test plans, claim this work with the applicable Defect Code and the labor operations listed in AIR (including diagnosis).

QUESTIONS REGARDING THIS BULLETIN

Technical inquiries	Submit feedback at the top of this bulletin
Warranty inquiries	Please contact the Warranty department by either using the Live Chat that's available in the Warranty Documentation Portal or through IDS by selecting Coverage, Policy, Coding Questions and Mileage Corrections
Parts inquiries	Submit an IDS ticket to the Parts Department