
PuMA measure

Battery Does Not Charge Via On-Board Socket

US 55297495-06 - 7/17/21

Complaint:

Vehicle battery not charged despite the battery charger being connected to the on-board socket (manufactured before 2009)

Headlights and rear lights light up intermittently despite the ignition being switched off and the battery charger being connected to the on-board socket.

Cause

Software error in the battery chargers 77 02 525 764/765/766.

Measure

When using the previously mentioned chargers on the concerned vehicles, connect the charger directly to the battery; do not charge through the on-board socket.

The updated BMW Motorrad battery charger 77 02 8 551 897 is able to charge through the on-board socket.

NOTE:

Vehicles manufactured from 2009 onwards can be charged using the on-board socket without faults.

Validity information

Model series:	[K71, K40, K72, K43, K25, K28, K27, K29]
Engine range:	[ALL]
Body style:	[ALL]
Fault codes:	[]
Production period:	to 12/30/08

Repair overviews
