



Bulletin No.: PIP5813
Published date: 07/9/2021

Preliminary Information

PIP5813 Replacement Camshaft Information

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado LD	2015 - 2019	All	All	5.3L L83	All
Chevrolet	Suburban	2015 - 2020	All	All	5.3L L83	All
Chevrolet	Tahoe	2015 - 2020	All	All	5.3L L83	All
GMC	Sierra Limited	2015 - 2019	All	All	5.3L L83	All
GMC	Yukon	2015 - 2020	All	All	5.3L L83	All

Involved Region or Country	North America
Condition	A vehicle may have a need for Camshaft replacement or have misfires on non AFM cylinders after the camshaft was replaced.
Cause	The camshaft may have been boxed incorrectly.

Correction:

Prior to installation, inspect the end of the camshaft, as the last 3 digits of the part number will be at this location (as seen below).

The camshaft below showing the 911 is for the L84 part number 12664911



The label below shows the correct camshaft part number 12619823 for L83 the camshaft above should have 823 NOT 911 etched on the end.



Version History

Version	1
Modified	07/08/2021 - Created on.



© 2021 General Motors. All Rights Reserved.