

Published date: 07/15/2021

# **Preliminary Information**

# PIC6441 Replacing & Programming the K218 - Front Suspension Leveling / Lifting Hydraulic Power Pack Module

## **Models**

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions:
			from	to	Engine:	Transmissions.
Chevrolet	Corvette	2020 - 2021	All	All	All	All

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this Pl.

Involved				
Region or	North America			
Country				
Additional RPO E60				
l ondition	Some technicians may find that they are unable to successfully program the K218 Front			
	Suspension Leveling / Lifting Hydraulic Power Pack Module after it has been replaced.			
( Oncern	This may be due to a software anomaly. This will require that the Serial Data Authentication			
	Procedure must first be run before the SPS programming selection.			

#### **Correction:**


To correctly program this new K218 module, please make sure all the standard programming instructions are being followed for the "Vehicle Intelligence Platform" (VIP) vehicles.

First, make sure the Midtronics Battery Maintainer is properly connected to the vehicle and verify that the vehicle is in the OFF power mode.

This is different than the traditional "Global A" vehicles of years past.

After this has been verified, manually select the "Serial Data Authentication Configuration" selection, as found in

This button can be seen in the photo below.

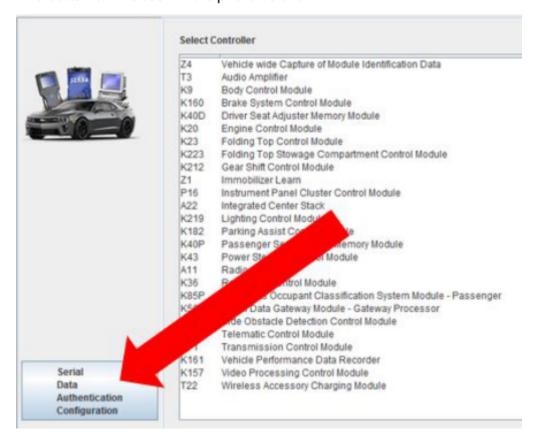

Once that has run and completed successfully, the regular SPS programming selection for this module should be selected, and it should successfully complete.

If this does not work for any reason, simply contact the Techline Customer Support Center (TCSC) for programming assistance.

Please do not contact the Technical Assistance Center (TAC) as this is a programming related issue.

TAC will be unable to assist with any programming related issues whatsoever.

# **Warranty Information**

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

### **Version History**

Version	1
Modified	7/15/2021 - Created.



© 2021 General Motors. All Rights Reserved.