

Bulletin No.: PIP5776F Published date: 07/19/2021

Preliminary Information

PIP5776F Misfire Due To Collapsed Lifter

<u>Models</u>

Duon du	Model:		Model Years:	VIN:		Enginer	Trenersiesienes
Brand:				from	to	Engine:	Transmissions:
Cadillac	Escalade		2021	September 1, 2020	March 31, 2021	6.2 L87	All
Chevrolet	Silverado 1500		2020 - 2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
Chevrolet	Suburban		2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
Chevrolet	Tahoe		2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
GMC	Sierra 1500		2020 - 2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
GMC	Yukon		2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
Holden / GMSV	Silverado 150 Only)	Silverado 1500 (4WD Only)		September 1, 2020	March 31, 2021	6.2 L87	All
Involved Region or Country		North America, Middle East, Australia and New Zealand					
Condition		The vehicle may come in with a P0300 - P0308 set with a bent push rod that leads to a Collapsed lifter or a lifter that come apart.					
Cause		Internal lifter concern.					

Correction:

If service information leads to a collapsed lifter and/or lifter has come apart including a bent pushrod it will be necessary to follow the replacement guideline below.

- If vehicle has under 8000 miles (12,875km) and is within the breakpoint window it will be necessary to replace all lifters and guides on both banks.
- If vehicle has over 8000 miles (12,875km) and is within the breakpoint window it will be necessary to replace the lifters and guides on the effected bank only not both.

Breakpoint for the models effected September 1, 2020 to March 31, 2021

When replacing the lifter and guide please indicated which lifter has failed by marking its location on the guide for inspection (please do not cover the date code). The parts will be requested back.

Note: It is not necessary to replace the oil control solenoid for this failure mode.

If the vehicle does not fall into the breakpoint window, please follow the latest version of 19-NA-218..

Warranty Information

For this repair use the published labor time as called out in SI Labor Time Guide.

Version History

Version	7
	01/20/2021 - Created on.
	02/23/2021 - Added the Middle East
	03/04/2021 - Updated to clarify models.
Modified	04/23/2021 - Update to change the correction statement
	05/17/2021 - Update to add breakpoint and remove 2019 MY
	06/18/2021 - Updated to add repair information
	7/15/2021 - Updated to add regions.
	06/18/2021 - Updated to add repair information



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.