



## Preliminary Information

### PIT5848 Front Windshield Wipers Only Work On High Speed

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Encore GX	2021	1-Jan-2021	15-Mar-2021	All	All
Chevrolet	Trailblazer	2021	1-Jan-2021	15-Mar-2021	All	All

Involved Region or Country	North America
Condition	<p><b>A customer may comment that the front wipers only work on high speed.</b></p> <p><b>The delay and low speed wiper functions are inoperative.</b></p> <p><b>When using the GDS2 scan tool and monitoring the wiper/washer data in the BCM, all the switch inputs will be correct.</b></p>
Cause	<b>Engineering has found an internal issue with the X50A Fuse Block-Underhood.</b>

#### Correction:

If the vehicle falls between the build dates listed above, then replace the X50A Fuse Block-Underhood.

Refer to the Electronic Part Catalog (EPS) for appropriate usage.

#### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4041870	Engine Wiring Harness Junction Block Replacement	Use Published Time

#### Version History

Version	1
Modified	07/19/2021 - Created



GENERAL MOTORS