



## Preliminary Information

### PIP5815 Check Engine Light on With P0011 And /Or P0021 Set in the ECM on Camaro With Less Than 150 Miles.

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Camaro	2021	All	All	3.6 LGX	All

Involved Region or Country	North America
Condition	We have seen some 2021 Camaro's with the HFV6 3.6L LGX engine come in with the SES/ CEL/ MIL on and DTC's P0011 and or P0016 set in the ECM. This is happening on brand new vehicles with less than 150 miles.
Cause	At this time we are unsure of the cause for this concern but replacement of the solenoids has shown the solenoid is not internally failed.

#### Correction:

At this time we would like you to cycle the connector to both intake camshaft actuator solenoids(unplug inspect connector and plug it back in).

Then take the vehicle and drive it to see if the code returns.

If the code(s) return, follow SI diagnostics for repair.

If the code does not return, return the vehicle to the customer.

**NOTE: The root cause for this concern is under investigation and this PI will be updated or removed when more information is known.**

#### Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4088138	Cycle The Intake Camshaft Actuator Connectors	0.3 Hrs.
<b>*This is a unique Labor Operation for Bulletin use only.</b>		

#### Version History

Version	<b>1</b>
Modified	PIP5815 created on - 07/22/2021



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.