



Preliminary Information

PIT5848A Front Windshield Wipers Only Work On High Speed

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Encore GX	2021	1-Jan-2021	31-Mar-2021	All	All
Chevrolet	Trailblazer	2021	1-Jan-2021	31-Mar-2021	All	All

Involved Region or Country	North America
Condition	<p>A customer may comment that the front wipers only work on high speed.</p> <p>The delay and low speed wiper functions are inoperative.</p> <p>When using the GDS2 scan tool and monitoring the wiper/washer data in the BCM, all the switch inputs will be correct.</p>
Cause	Engineering has found an internal issue with the X50A Fuse Block-Underhood.

Correction:

If the vehicle falls between the build dates listed above, then replace the X50A Fuse Block-Underhood.

Refer to the Electronic Part Catalog (EPS) for appropriate usage.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4041870	Engine Wiring Harness Junction Block Replacement	Use Published Time

Version History

Version	1
Modified	07/19/2021 - Created on 07/26/2021 - Expanded build date to 03/31/2021



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.